



Building
something
great

June 2026

Pollution Incident Response Management Plan

Beryl Quarry



DOCUMENT CONTROL SHEET

Rev.	Date	Prepared by	Approved By	Revision Details
01	20 Aug 2012	Rod Johnson	Rod Johnson	Document Created
02	12 Dec 2012	Phillip Paterson	Rod Johnson	Document control sheet added
03	10 Apr 2013	Nathan Jeffery	Rod Johnson	Format Changes Added additional maps Added quantities of substances
04	19 Nov 2013	Nathan Jeffery	Rod Johnson	Corrected Council contact details Updated staff contact details Added Immediate Reporting Contact Sheet Update SOP reference for incident reporting Update reference map to reduce file size
05	9 Sep 2014	Rod Johnson	Rod Johnson	Updated Staff contact details
06	25 Sep 2015	Danielle Griffiths	Danielle Griffiths	Updated Staff contact details Updated risk rankings to reflect current risk matrix
07	11 Sep 2016	Danielle Griffiths	Danielle Griffiths	Updated Staff contact details Update document references to HSEQ MS
08	5 Oct 2017	Dylan Treadwell	Danielle Griffiths	Update contact details of staff Update reference to Notification Authority list Update Immediate Contact Sheet Update PIRMP Incident actions to include clean up
09	09 Mar 2020	Pere Riini	Pere Riini	Update contact details of staff
10	24 Aug 2020	Pere Riini	Pere Riini	Update contact details of staff
11	30 Mar 2021	Shoanne Labowitch	Pere Riini	Update contact details of staff Update formatting
12	20 June 2022	Sharon Makin	Ryan Stacey	Update contact details of staff Update formatting
13	21 June 2023	Chris Brown	Thomas Emerson	Update contact details of staff Update formatting
14	19 June 2024	Chris Brown	Thomas Emerson	Update contact details of staff Addition of incident #10
15	20 June 2025	Chris Brown	David Simpson	Update contact details of staff Addition of incident #11
16	19 June 2026	Chris Brown	Josh Grobler	Updated for POEO (General) Regulation 2022 and Environmental Legislation Amendment Act 2025: Ch. 4 remap, \$50k threshold, NSW Health non-mandatory, agency renames, post-incident testing, Section 14 role reference, contacts updated.

Table 1 Document control register

Current Rev.	Date Implemented	PIRMP Test Schedule	Date for Next Review
16	19 June 2026	12 months	19 June 2027

TABLE OF CONTENTS

PART A: COMPLIANCE REQUIREMENTS, POLLUTION INVENTORIES AND RISK ASSESSMENTS	5
1. PURPOSE	6
2. LEGISLATIVE REQUIREMENTS.....	6
3. DEFINITION OF 'POLLUTION INCIDENT'	9
4. SCOPE.....	10
5. SITE LAYOUT	11
6. POTENTIAL POLLUTING SUBSTANCES	14
7. ROLES AND RESPONSIBILITIES.....	19
8. INTERNAL POLLUTION INCIDENT REPORTING	20
9. EXTERNAL POLLUTION INCIDENT REPORTING	21
10. POLLUTION INCIDENT AUTHORITY CONTACT LIST	22
11. INCIDENT RESPONSE TRAINING.....	23
12. PIRMP TESTING	24
13. PIRMP REVIEW.....	24
PART B: INCIDENT RESPONSE ACTIONS AND NOTIFICATION LOGS	29
14. PIRMP RESPONSE ACTIONS.....	30
15. POLLUTION INCIDENT NOTIFICATION LOG	52
16. IMMEDIATE NOTIFICATION SHEET SUMMARY	54

TABLE OF FIGURES

Figure 1 - Beryl Quarry Location Map	11
Figure 2 - Beryl Quarry Reference Map	12
Figure 3 - Beryl Quarry – Map Of Affected Areas	13

TABLE OF TABLES

Table 1 Document control register	2
Table 2: Summary of Legislative Requirements of a PIRMP	7
Table 3 Potential Pollutants	15
Table 4 Roles and Responsibilities	19
Table 5 Internal Contacts List	20
Table 6 External Authorities Contact List	22
Table 7 - PIRMP Drills Undertaken at Beryl Quarry	23
Table 8 - Internal Reporting List	54
Table 9 - External Reporting List	54

**PART A: COMPLIANCE REQUIREMENTS, POLLUTION INVENTORIES AND RISK
ASSESSMENTS**

1. PURPOSE

The purpose of the Beryl Quarry Pollution Incident Response Plan is to:

- Provide direction to the staff at Beryl Quarry in responding to pollution incidents at the Beryl operations;
- Ensure timely communication about a pollution incident is provided to staff at the premises, the Environment Protection Authority (EPA), other relevant authorities specified in Part 5.7 of the POEO Act (including Mid-Western Regional Council, SafeWork NSW, and Fire and Rescue NSW) and persons outside the operations who may be affected by the impacts of a pollution incident;
- Minimise and control the risk of a pollution incident at Beryl Quarry by identifying key risks and planned actions to minimise and manage those risks;
- Detail the training requirements for this plan, identifying persons responsible for implementing it, and ensuring that the plan is regularly tested for accuracy, currency and suitability.
- A hard copy of the PIRMP is to be kept on the site environmental board in the Beryl Quarry Main Office. A soft copy of the PIRMP and EPL 3630 is made available online <https://www.boral.com.au/our-commitment/environmental-reporting>.

2. LEGISLATIVE REQUIREMENTS

The specific requirements for a Pollution Incident Response Management Plan (PIRMP) are set out in Part 5.7A of the POEO Act and the Protection of the Environment Operations (General) Regulation 2022 (POEO (G) Regulation). Chapter 4 of the POEO (G) Regulation 2022 describes the specific components and requirements of a PIRMP.

Table 2 summarises the location of these requirements within the document.

Table 2: Summary of Legislative Requirements of a PIRMP

Section/Clause	Requirement	Location in PIRMP
Part 5.7A POEO Act 1997		
147	(1) For the purposes of this Part— (a) harm to the environment is material if— (i) it involves actual or potential harm to the health or safety of human beings or to ecosystems that is not trivial, or (ii) it results in actual or potential loss or property damage of an amount, or amounts in aggregate, exceeding \$50,000 (or such other amount as is prescribed by the regulations), and (b) loss includes the reasonable costs and expenses that would be incurred in taking all reasonable and practicable measures to prevent, mitigate or make good harm to the environment. (2) For the purposes of this Part, it does not matter that harm to the environment is caused only in the premises where the pollution incident occurs.	Section 3
153A	The holder of an environment protection licence must prepare a pollution incident response management plan that complies with this Part in relation to the activity to which the licence relates.	EPL 3630 and this document
153C	A pollution incident response management plan must be in the form required by the regulations and must include the following— (a) the procedures to be followed by the holder of the relevant environment protection licence, or the occupier of the relevant premises, in notifying a pollution incident to— (i) the owners or occupiers of premises in the vicinity of the premises to which the environment protection licence or the direction under section 153B relates, and (ii) the local authority for the area in which the premises to which the environment protection licence or the direction under section 153B relates are located and any area affected, or potentially affected, by the pollution, and (iii) any persons or authorities required to be notified by Part 5.7, (b) a detailed description of the action to be taken, immediately after a pollution incident, by the holder of the relevant environment protection licence, or the occupier of the relevant premises, to reduce or control any pollution, (c) the procedures to be followed for coordinating, with the authorities or persons that have been notified, any action	Section 8 and 9 Section 6 Section 7, 8, 9, 10 and 14 Section 7, 8, 9, 10 and 14 Section 15

	taken in combating the pollution caused by the incident and, in particular, the persons through whom all communications are to be made, (d) any other matter required by the regulations.	Section 7, 8, 9, 10 and 13 Section 9, 14
153D	A person who is required to prepare a pollution incident response management plan under this Part must ensure that it is kept at the premises to which the relevant environment protection licence relates, or where the relevant activity takes place, and is made available in accordance with the regulations.	Section 1
153E	A person who is required to prepare a pollution incident response management plan under this Part must ensure that it is tested in accordance with the regulations	Section 11,12
153F	If a pollution incident occurs in the course of an activity so that material harm to the environment (within the meaning of section 147) is caused or threatened, the person carrying on the activity must immediately implement any pollution incident response management plan in relation to the activity required by this Part	Section 4, Section 14
Chapter 4 POEO(G) Regulation 2022 Pollution Incident Response Management Plans note: See also 153C (a)-(c) of the POEO Act 1997		
72 (a)	A description of the hazards to human health or the environment associated with the activity to which the licence relates,	Section 6, Appendix 1
72 (b)	The likelihood of any such hazards occurring, including details of any conditions or events that could, or would, increase that likelihood,	Appendix 1
72 (c)	Details of the pre-emptive action to be taken to minimise or prevent any risk of harm to human health or the environment arising out of the relevant activity	Section 9, Appendix 1, Section 14
72 (d)	An inventory of potential pollutants on the premises or used in carrying out the relevant activity	Section 6
72 (e)	The maximum quantity of any pollutant that is likely to be stored or held at particular locations (including underground tanks) at or on the premises to which the licence relates,	Section 6
72 (f)	A description of the safety equipment or other devices that are used to minimise the risks to human health or the environment and to contain or control a pollution incident,	Section 6, Appendix 1
72 (g)	the names, positions and 24-hour contact details of those key individuals who: I. are responsible for activating the plan, and II. are authorised to notify relevant authorities under section 148 of the Act, and	Section 8 16

	III. are responsible for managing the response to a pollution incident,	
72 (h)	the contact details of each relevant authority referred to in section 148 of the Act,	Section 9, 16
72 (i)	Details of the mechanisms for providing early warnings and regular updates to the owners and occupiers of premises in the vicinity of the premises to which the licence relates or where the scheduled activity is carried on	Section 10
72 (j)	The arrangements for minimising the risk of harm to any persons who are on the premises or who are present where the scheduled activity is being carried on	Section 9, Appendix 1
72 (k)	A detailed map (or set of maps) showing the location of the premises to which the licence relates, the surrounding area that is likely to be affected by a pollution incident, the location of potential pollutants on the premises and the location of any stormwater drains on the premises	Section 5
72 (l)	A detailed description of how any identified risk of harm to human health will be reduced, including (as a minimum) by means of early warnings, updates and the action to be taken during or immediately after a pollution incident to reduce that risk,	Section 9, Appendix 1
72 (m)	The nature and objectives of any staff training program in relation to the plan	Section 11
72 (n)	The dates on which the plan has been tested and the name of the person who carried out the test,	Table 7
72 (o)	The dates on which the plan is updated,	Document Control Sheet
72 (p)	The manner in which the plan is to be tested and maintained.	Section 11, 12, 13
74	Availability of plan - kept at the premises, available to an authorised officer on request, and made publicly available on a website within 14 days after it is prepared.	Section 1
75	Testing of the PIRM plan - routinely at least once every 12 months, and within one month of a pollution incident that caused or threatened material harm to the environment.	Section 11, 12

3. DEFINITION OF 'POLLUTION INCIDENT'

The definition of a pollution incident is:

"pollution incident means an incident or set of circumstances during or as a consequence of which there is or is likely to be a leak, spill or other escape or deposit of a substance, as a result of which pollution has occurred, is occurring or is likely to occur. It includes an incident or set of

circumstances in which a substance has been placed or disposed of on premises, but it does not include an incident or set of circumstances involving only the emission of any noise.”

A pollution incident is required to be notified if there is a risk of ‘material harm to the environment’, which is defined in section 147 of the POEO Act as:

a) harm to the environment is material if:

- i. it involves actual or potential harm to the health or safety of human beings or to ecosystems that is not trivial, or
- ii. it results in actual or potential loss or property damage of an amount, or amounts in aggregate, exceeding \$50,000 (or such other amount as is prescribed by the regulations), and

b) loss includes the reasonable costs and expenses that would be incurred in taking all reasonable and practicable measures to prevent, mitigate or make good harm to the environment.

Beryl Quarry is now required to report non-trivial pollution incidents immediately to the EPA, Fire and Rescue NSW, SafeWork NSW and the local council.

4. SCOPE

This PIRMP must be followed by employees, contractors and visitors of Beryl Quarry, to assist in the early response to and reporting of a pollution incident.

5. SITE LAYOUT

Figure 1 - Beryl Quarry Location Map

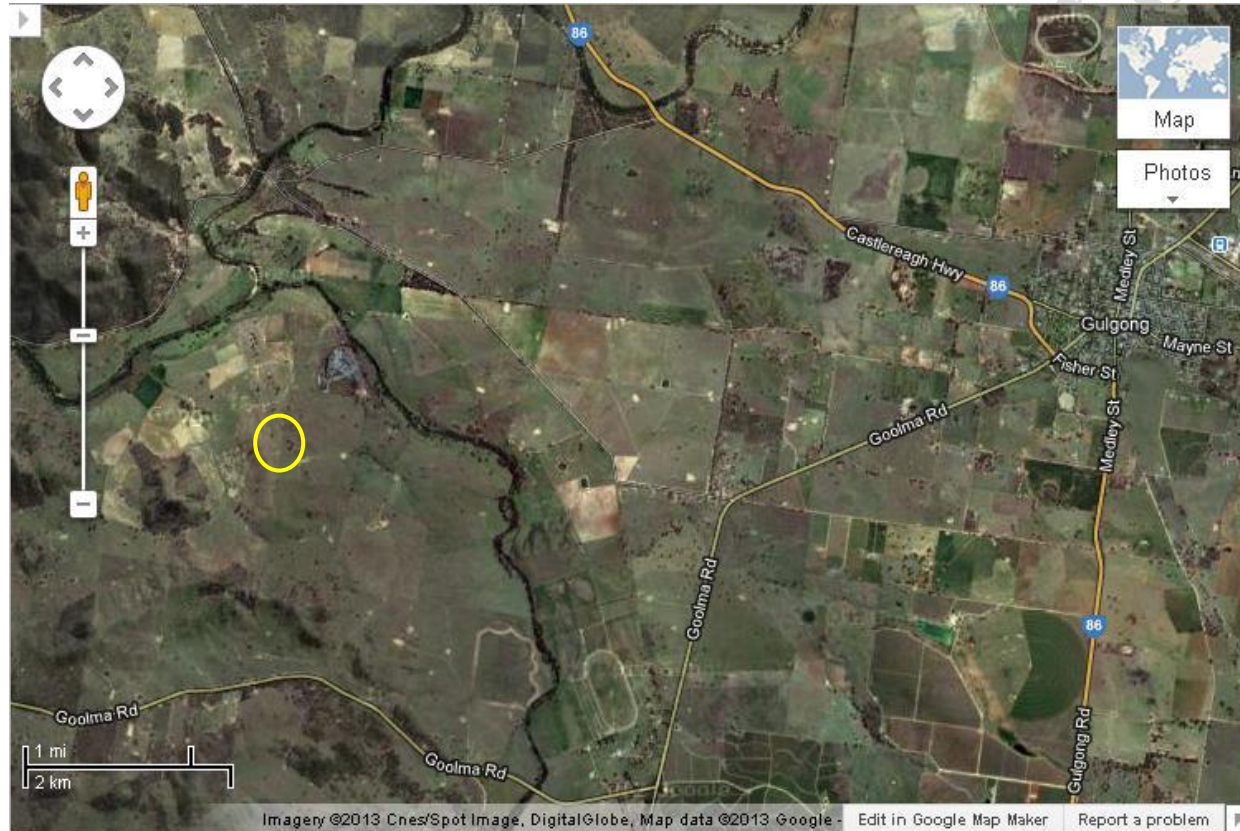


Figure 2 - Beryl Quarry Reference Map



Figure 3 - Beryl Quarry – Map Of Affected Areas



6. POTENTIAL POLLUTING SUBSTANCES

Table 3 below is an inventory of potential pollutants kept on the premises. This inventory provides a description of the main hazards to human health or the environment, an assessment of the likelihood of the hazards occurring and also includes the current controls and safety equipment and/ or pre-emptive actions in place to minimise or prevent risk of harm to human health or the environment.

Public Document

Table 3 Potential Pollutants

LIST OF POLLUTING SUBSTANCE STORAGES/USES AT SITE: INITIAL ASSESSMENT (all Chemicals listed in this sheet are to be subjected to a risk assessment)							
Site Name: Beryl Quarry					Responsible Person: Quarry Manager		Date: 19/06/2026
Name / description	Covered under Haz Chemicals/MSDS?	Amount stored	Location of storage	Map reference	Need for early warning ¹	Current controls	See Risk Ass & PIRMP Response Action (see Below)
CHEMICALS/FUELS/LUBRICANTS (raw materials and products which can cause pollution)							
Diesel	Class 3	10 000 ltrs	Diesel Storage Area	Ref No #1	N/A	• Bunding • PMP • Training • Spill Kits • SOP • Inductions • Fire Fighting Equipment • Security	Incident #1-2, 11
Precoat	Class 3	22 000ltrs	Precoat Storage Area	Ref No #3	N/A	• Bunding • PMP • Training • Spill Kits • SOP • Inductions	Incident #1-3, 11

¹ Early warnings relate to informing neighbours who may be affected by the emission of this substance. If this substance is of a type and quantity which may reach neighbours then early warning assessment of actions is required to be undertaken.

						• Fire Fighting Equipment • Security	
Oils/Solvents	Class 3	Packaged goods up to 600ltrs	Oil Storage Shed at Workshop	Ref No #2	N/A	• Bunding • PMP • Training • Flammable Cabinet • Spill Kits • Inductions • Fire Fighting Equipment • Security	Incident #4, 11
Lubricants, Gases	Class 2	Variable	Maintenance Workshop	Ref No #2	N/A	• Fire Extinguishers • Concrete Floor • Enclosed Shed • Containment Cages and Cabinets	Incident #4, 11
Oils/Fuel	Class 3	Variable	Plant and Equipment (Workshop area)	Ref No #2	N/A	• PMP • Training • Spill Kits • SOP • Inductions • Fire Fighting Equipment • Security	Incident #4, 11
MATERIALS (eg stockpiles, silos, bulk solids etc)							
Product Stockpiles	N/A	Variable	Dedicated on site	Ref No #8 & #9	N/A	• Water sprays • Water Cart • Maintain manageable levels	Incident #5

						Security	
AQUEOUS (eg dams, wastewater tanks, other water storage area)							
Water Storage Dam (Sediment)	N/A	Variable		Ref No #6	N/A	- Continue to use for dust suppression - Ensure pumps are maintained through scheduled maintenance - Discharge monitoring	Incident #6
Storm Water Drains	N/A	Variable	Site	N/A	N/A	- Straw Bales - Rubber and Earthen Berms - Audits and Inspections	Incident #6
SUBSTANCES IN PROCESSES (substances which could be emitted from operational process i.e. treatment plants, vehicles etc)							
Name / description	Covered under Haz Chemicals/MSDS	Amount stored	Location of storage	Map reference	Need for early warning ²	Current controls	See Risk Ass & PIRMP Response Action (see Below)
Mobile Plant (onsite) BORAL	Class 3	Up to 10 MP on site	Dedicated on site	N/A	N/A	- Spill Kits - Pre start checks - PMP - Training	Incident #7

² Early warnings relate to informing neighbours who may be affected by the emission of this substance. If this substance is of a type and quantity which may reach neighbours then early warning assessment of actions is required to be undertaken.

Mobile Plant Contractor/visitor	Class 3	Variable	Variable Locations	N/A	N/A	• Spill Kits • Training • Inductions	Incident #8
Car Parking up to 20 vehicles	Class 3	Variable	Site Office	Ref No #4	N/A	• Spill Kits • Training	Incident #9
Traffic Areas (dust, chem. leaks & loss)	Class 3	N/A	Dedicated on site	N/A	N/A	• Training • Water cart • Spill Kits	Incident #10
Excessive blast fume from blasts causing significant and unexpected impact to the community	N/A	Blast fume containing NOX, SOX	Active production pit area onsite	N/A	Only if explosives are dormant for excessive periods of time and exposed to water during blasting and prevailing winds push fumes towards community	• Blast Management Plan • Procedures • PMP • Training • Don't sleep shots for excessive periods (ie 7+ days) • Avoid loading into wet holes	Incident #11

7. ROLES AND RESPONSIBILITIES

Table 4 Roles and Responsibilities

Position	Responsibility
<i>Employees and Contractors</i>	Following the procedures outlined in the PIRMP and related documents Immediately alerting Supervisor or Team Leader of any environmental incidents or near-misses.
<i>Team Leaders / Front Line Supervisors</i>	Following the procedures outlined in the PIRMP and related documents Immediately alerting Site/Quarry Manager or, in case of their unavailability, Environmental Representative or Environment Manager of any potentially material environmental incidents or near-misses. Conducting incident investigations.
<i>Site / Operations Manager and/or</i> <i>Site Environmental Coordinator and/or</i> <i>Environment Manager</i>	Authorisation of the PIRMP Administration, maintenance and implementation of the PIRMP Assessing whether the incident has caused or threatens “material environmental harm” and, if so, immediately notifying all Appropriate Regulatory Authorities. Ensuring that investigations are undertaken to a level corresponding to the level of risk and impact.
<i>HSE Regional Manager and/or</i> <i>Regional Environment Manager</i>	Make a determination as to whether the incident (as defined in section 147 of the POEO Act) is non-trivial and therefore reportable to external agencies Inform Executive General manager and Group management of Notification to External Agencies Undertake notifications as defined in PIRMP Authorise notifications to public and/or media following GRP-HSEQ-2-02

8. INTERNAL POLLUTION INCIDENT REPORTING

Any pollution incident satisfying the **material harm** threshold must be immediately reported to relevant statutory authorities by either the Site/Operations Manager, or Environment Manager.

In cases where material harm level cannot be immediately assessed or insufficient information comes to hand on the severity of the incident, the general advice is to err on the side of caution and notify the Relevant Authorities with a qualification that the situation could not yet be fully assessed.

Until further notice the following procedure needs to be followed:

1. When a pollution incident occurs, a person who has become aware of it must immediately bring it to the attention of his/her immediate Supervisor or Manager
2. If necessary, first ring 000 for Emergency Services
3. At least one of the following BCM personnel must be contacted **immediately**:

Table 5 Internal Contacts List

Name	Function	Phone number	Mobile number

Note: Contact details removed from online version for privacy reasons.

4. The quarry manager, or in case of his unavailability one of the Senior Management personnel listed above, is to **immediately** notify all Appropriate Regulatory Authorities specified in Section 9.
5. In borderline situations, where the exceedance of the trigger level of “material harm” of a pollution incident may not be clear, a quick assessment including consultation with Boral environmental personnel should be undertaken to help the decision whether to notify or not.

6. Boral's Senior Management must be informed promptly of the fact of immediate notification to the Authorities. This includes environmental personnel listed above, as well as Greg Johnson, Josh Grobler, Dean Beltrame and Mark Campbell.

9. EXTERNAL POLLUTION INCIDENT REPORTING

As the legislation requires that notification must be done immediately upon becoming aware of the pollution incident, it is unlikely that a detailed picture will be available for reporting. Notwithstanding, it seems that some of the Government Authorities prepared a detailed questionnaire which is being filled at the time of this initial notification. Under the stress of incident handling it could be easy to provide a hasty, inaccurate estimate of the situation when answering these questions.

Therefore, the notification should be restricted to the facts known and nothing should be assumed or guessed. The details will be provided to the asking Authority later when more information comes to hand.

The initial notification should include as much of the following information (if known) as possible:

- location and time of the pollution incident
- type of the incident (spill, fire, unlicensed harmful discharge, etc)
- assessed level of incident gravity: "it seems to be..." (e.g. "a relatively minor spill"; "major fire", "explosion limited to one building", etc.)
- whether the Emergency Services have been required to attend.

Unless known for a fact, the answers to other questions should be politely deferred until a better assessment of the situation can be made.

The Boral person who is responsible for notifying the Authorities (NSW HSE Regional Manager or Senior Environmental Business Partner) about the incident must prepare a Notification Log (a suitable form is attached) with the details of time of notifications and the persons who took to the call. The Authorities will generally provide an Incident Notification Number.

Notification of all Appropriate Government Authorities (at least 4 entities) may take considerable time. Delays may be experienced connecting to the right person or no contact may be possible after hours. All such instances should be recorded in the Notification Log.

10. POLLUTION INCIDENT AUTHORITY CONTACT LIST

Table 6 External Authorities Contact List

Government Authority - compulsory notifications	Emergency notification phone number
EPA – Environment Line	131 555
Fire & Rescue NSW (FRNSW)	1300 729 579
Mid-Western Regional Council	1300 765 002
SafeWork NSW	131050 Company ABN asked: 51 000 187 002
Government Authority - ring if relevant	Emergency notification phone number
Public Health Unit (Greater Western) – Dubbo GW PHU (notify if potential health impacts)	HealthLink (24 hr)- 1800 063 635 Head Office- Dubbo- 6841 5569
Police & Ambulance	000
Transport for NSW (road spills)	132 701
WaterNSW	1300 662 077
Bush Fire Control Officer	1800 049 933
Poisons Information Centre	131 126
Essential Energy (power line emergencies)	13 23 91

Communication with the local community may also be undertaken depending on the circumstances of the pollution incident. Beryl Quarry would consider the following options for providing Early Warning and ongoing information to the community on pollution incidents:

- Direct phone contact with any local residents directly impacted by the pollution incident
- Letter Box drops of incident information and site contacts to local residents impacted by the pollution incident

The Stakeholder Relations Manager can assist in the process of communicating with the community, as per the Stakeholder Engagement Plan for the site.

11. INCIDENT RESPONSE TRAINING

Beryl Quarry will implement the Pollution Incident Response Management Plan by training or providing information to relevant employees and contractors in relevant areas of the Plan.

The nature and objectives of staff training is to relate to site personnel the importance of early notification of any incidents and spills to site supervisors and key personnel.

Training or information will be provided on the following;

- The contents and intent of this PIRMP,
- The roles and responsibilities of site staff in relation to this PIRMP
- Spill response procedures;
- General environmental awareness; and / or
- Hazardous materials awareness.

Site inductions for visitors and sub-contractors also advise individuals to report any environmental incidents or spills to site supervisors and key personnel immediately. Key site personnel and supervisors participate in PIRMP Tests which are used as practical training and can also be used to identify any potential gaps or areas for improvement for the PIRMP. A summary of the PIRMP Drills undertaken at Beryl Quarry is shown below in Table 7.

Table 7 - PIRMP Drills Undertaken at Beryl Quarry

Test Date	Version tested	Incident Drilled	Drill Team Lead
March 2020	10	Desktop review of document	Shoanne Labowitch
June 2022	11	Desktop review of document	Sharon Makin
June 2023	12	Desktop review of document	Chris Brown
June 2024	13	Oil drum fire	Thomas Emerson
June 2025	14	Diesel Spill	Chris Brown
June 2026	15	Loss of diesel caused by truck colliding with weighbridge – Incident #2	Chris Brown

A sign-off sheet is kept of the personnel present for the undertaking of a PIRMP Drill and a record is kept on when and how the PIRMP is communicated to employees. This information forms a section of the PIRMP Drill document. For more information regarding each of the PIRMP Drills, refer to the specific drill document.

12. PIRMP TESTING

Plans must be tested routinely at least once every 12 months, and within one month of any pollution incident that causes or threatens material harm to the environment (clause 75, POEO (General) Regulation 2022). The testing is to be carried out in such a manner as to ensure that the information included in the plan is accurate and up to date, and that each plan is capable of being implemented in a workable and effective manner.

The objectives of an audit are to maintain compliance with this plan. Internal audits of this Plan will be undertaken every 3 years.

Routine testing of the PIRMP will be conducted annually, and can be completed through the following methods:

- Simulated environmental emergency; or
- Desktop simulations.

13. PIRMP REVIEW

Revisions are to be coordinated by the Site Manager and Environmental Representative.

The objectives of a review are:

- To maintain compliance with the statutory requirements, and
- To identify opportunities for improvement in the Plan, and reduce the risk to human health and the environment

13.1. EVENT BASED

Events which may trigger a review of this Plan or its associated documents include:

- Within 1 month of reporting to the nominated parties in accordance with the plan, after a pollution incident, or
- Modification/Improvement to the system

13.2. TIME BASED

Beryl Quarry will review this management plan routinely every 12 months. The Plan review will include:

- This Document, and
- Legislation, Approval and Licence changes.

Public Document

APPENDIX 1.

RISK ASSESSMENT on POTENTIAL IMPACTS

Hazard and Likelihood Risk Assessment and Corrective Control Measures								
Site: Beryl Quarry			Responsible Person: Quarry Manager/Supervisor			Reviewed Date: 19/06/2026		
Name / ref of pollutant/ chemicals	Description of Hazard / Incident leading to hazard	Consequence	Likely hood	Risk	Impact on neighbours ³	Control Measures Corrective Action Coverage under other Plans	Responsible person	Action date
Diesel	Incident #1 Catastrophic failure of one/both above ground tanks	2	1	L	N/A	Consequence: (minor): Failure resulting in loss of all or substantial volume of tanks would be captured entirely by existing primary bund with no release to soil or water. Likelihood: (unlikely): Tanks is a double walled self bunded storage tank. Due to location of tank damage to tanks is unlikely to occur from external equipment. In addition tanks are maintained in good structural integrity with low risk of failure through corrosion.	As per PIRMP action plan	When required
	Incident #2 Loss of diesel outside bund during refuelling/fuelling operations.	2	2	L	N/A	Consequence: (minor): Failure resulting in loss/leakage from fuelling or re-fuelling from hose, nozzle or plant/equipment would be captured by a self bunded fill point or spill kill with minimal release to soil.	As per PIRMP action plan	When required

³ If the incident may impact on neighbours then it will need to trigger the early warnings assessment and actions

						Likelihood: (unlikely): Due to location within the tank structure an incident while re-fuelling and fuelling is likely to occur on some occasions. Hoses and refuelling equipment are maintained with low risk of failure.		
Oils/Solvents	Incident #3 Loss of oils solvents inside bund during delivery and or use	1	2	L	N/A	Consequence: (incidental): Failure resulting in loss of oils/solvents from packaged goods would be captured entirely by existing primary bund with no release to soil or water. Likelihood: (unlikely): Due to location within the bund, spillage during delivery and use is unlikely to occur. In addition hoses and decanting equipment are maintained in good structural integrity with low risk of failure.	As per PIRMP action plan	When required
Product stockpiles	Incident #4. Excessive airborne dust from stockpiled material	1	2	L	Y	Consequence: (incidental): Excessive dust from stockpile during high winds causing nuisance to surrounding area. Likelihood: (unlikely): Stockpiles are maintained to a manageable level on a monthly basis. Use of water sprinklers and water cart onsite during windy periods.	As per PIRMP action plan	When required
Sediment Dams	Incident #5 Catastrophic failure of one or more sediment dams releasing large volumes of water into on-site and off-site water courses (i.e creek).	1	2	L	N/A	Consequence: (incidental): Catastrophic failure of one or more sediment dams are likely to result in off-site impacts to water courses which would predominantly reduce water quality over a short period of time. As such, impact to the environment/human health is not considered to be significant. Likelihood: (unlikely): Dams are frequently monitored and inspected for levels and integrity. Note: For PIRMP purposes overflow events during extreme wet weather will be reported under POEO Licence obligations and not Immediate Reporting.	As per PIRMP action plan	When required

Mobile Plant	Incident #6 Mobile plant, hydraulic hose or fuel tank failure	1	2	L	N	Consequence: (incidental): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site. Likelihood: (unlikely): Hose or fuel tank failure from mobile plant would be minimal as prestart and regular maintenance programs are in place to capture and prevent such occurrences. Spills kits also maintain and available in various areas.	As per PIRMP action plan	When required
Mobile plant/ Contractor, Visitor	Incident #7 Mobile plant, hydraulic hose or fuel tank failure	1	2	L	N	Consequence: (incidental): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site. Likelihood: (unlikely): Hose or fuel tank failure from mobile plant would be minimal as prestart and regular maintenance programs are in place to capture and prevent such occurrences. Spills kits also maintain and available in various areas. Inductions for all contractors demonstrating their accountabilities and responsibilities for reporting environmental incidents.	As per PIRMP action plan	When required
Car Park	Incident #8 Ruptured fuel tank	1	2	L	N	Consequence: (incidental): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site. Likelihood: (unlikely): Hose or fuel tank failure from employee or visitor car would be minimal. Car park area is fully sealed. Spill kits also maintain and available in various areas	As per PIRMP action plan	When required
Traffic areas (dust)	Incident # 9 Surface dust from mobile plant	1	2	L	Y	Consequence: (incidental): Dust created form continuous mobile plant operations across site Likelihood: (unlikely): Main areas watered with water cart in high wind conditions	As per PIRMP action plan	When required

Smoke	Incident #10 Excessive smoke as a result of infrastructure or equipment fire causing significant and unexpected impact to the community	1	1	L	Y	Consequence: (minor) smoke would be visible but due to distance to the nearest receivers would have little impact Likelihood: (unlikely) fire fighting controls are in place in the operations and staff have been trained in fire fighting response. Maintenance schedule in place to ensure process and fire fighting equipment are in good working order. Emergency response training for Boral staff in place including fire response.	As per PIRMP action plan	When required
Blast fume	Incident #11 Excessive blast fume from blasts causing significant and unexpected impact to the community	1	1	L	Y	Consequence: (minor): Blast fume would be localised and dispersed with high winds, of short duration and not cause long term impacts. Likelihood: (unlikely):Blast Management Plan in place to reduce the likelihood of shots being slept for extended periods of time and not loaded into wet holes.	As per PIRMP action plan	When required

PART B: INCIDENT RESPONSE ACTIONS AND NOTIFICATION LOGS

Public Document

14. PIRMP RESPONSE ACTIONS

Incident No 1

Incident #1	Catastrophic failure of one/both diesel tanks. Actions Required: • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Ensure bunds are capturing full volume of diesel • Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) • Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents • Area to be restricted to Incident Response Personnel • Ensure spill kit available for any release from bund • If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. • Repair/replace tanks • Refuel tanks Inspect bund for ongoing serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be restricted to Diesel/Precoat storage area with minimal external impact, however, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager

	- Environmental Business Partner External mandatory: - Immediate Reporting Contact Sheet to be used External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.
Reporting and re-preparedness	Incident Notification (GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management)

Incident No 2

Incident #2	Loss of Fuel due to filling and refueling from one/both diesel tanks. Actions Required: • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Ensure bunds are capturing full volume of diesel • Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) • Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents • Area to be restricted to Incident Response Personnel • Ensure spill kit available for any release from bund • If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. • Repair/replace tanks • Refuel tanks Inspect bund for ongoing serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used

	External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 3

Incident #3	Loss off oil/solvents, packaged goods. Actions Required: • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Ensure bunds are capturing full volume of oil/solvents • Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) • Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents • Area to be restricted to Incident Response Personnel • Ensure spill kit available for any release from bund • If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. • Inspect bund for ongoing serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be restricted to chemical storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Supervisor • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A

Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + FirstAid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service Provider to dispose of diesel, oil, grease and advise on required clean-up.
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 4

Incident #4	Excessive airborne dust from stockpiled material. Actions Required: • Employees, Contractor/Visitor to notify site representative of issue immediately. (induction) • Daily monitoring to be undertaken to assess weather and site conditions • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Dust suppression activity to commence immediately on stockpiles
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be localised to the area surrounding stockpile area, with minimal external impact.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting

Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 5

Incident #5	Failure of one or more sediment dams. Actions Required: • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) • Contact local neighbours if going to be in inundated by rise of water • Area to be restricted to Incident Response Personnel • If any release from site onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination if any • Contact local contractor to rebuild dams immediately
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Catastrophic failure of one or more sediment dams are likely to result in off-site impacts to water courses which would predominantly reduce water quality over a short period of time. As such, impact to the environment/human health is not considered to be significant.
Evacuate	Only if flood potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A

Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Consultants to be contacted to advise on required clean-up.
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 6

Incident #6	Mobile plant, hydraulic hose or fuel tank failure. Actions Required: • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Area to be restricted to Incident Response Personnel • Ensure spill kit available for any release from mobile plant & equipment • Used spill kit absorbent pads to be stored in designated spill bags for correct disposal • If any release from mobile plant onto unsealed soil/surface water is investigated and remediated immediately • Call service provider to inspect plant & equipment for serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Quarry Supervisor)
Scale of incident	Incident would be localised to the area with no external impact.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A

Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 7

Incident #7	Mobile plant, hydraulic hose or fuel tank failure from contractors / visitors. Actions Required: • Contractor/Visitor to notify site representative of issue immediately. (induction) • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Area to be restricted to Incident Response Personnel • Ensure spill kit available for any release from mobile plant & equipment • Used spill kit absorbent pads to be stored in designated spill bags for correct disposal • If any release from mobile plant onto unsealed soil/surface water is investigated and remediated immediately • Call service provider to inspect plant & equipment for serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be localised to the area with no external impact.
Evacuate	Only if fire or explosion potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A

Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service Provider to dispose of contaminates.
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 8

Incident #8	Car Park/ fuel tank failure. Actions Required: - Contractor/Visitor to notify site representative of issue immediately. (induction) - Area to be restricted to Incident Response Personnel - Ensure spill kit available for any release from mobile plant - If any release from mobile plant onto unsealed soil/surface water is investigated and remediated immediately
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	- Quarry Supervisor - Spill Kit manager (Supervisor)
Scale of incident	Incident would be localised to the area with no external impact.
Evacuate	Only if fire or explosion potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: - Quarry Manager - Environmental Business Partner - External mandatory - Immediate Reporting Contact Sheet to be used External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and	Service Provider to dispose of contaminate

Waste disposal	
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 9

Incident #9	Dust from traffic areas. Actions Required: • Employees, Contractor/Visitor to notify site representative of issue immediately. (induction) • Daily monitoring to be undertaken to capture whether and site conditions • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Dust suppression activity to commence immediately on unsealed roads & dusty areas of site
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Supervisor • Quarry Supervisor to instruct site personnel
Scale of incident	Incident would be localised to the area with minimal external impact.
Evacuate	Only if fire or potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner • External mandatory • Immediate Reporting Contact Sheet to be used if required External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and	N/A

Waste disposal	
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 10

Incident # 10	Excessive smoke as a result of infrastructure or equipment fire causing significant and unexpected impact to the community Actions Required: • Employees, Contractors/Visitor to notify site representative of issue immediately. (induction) • Emergency response plan to be activated as necessary including firefighting if possible or calling Emergency Services • Area to be restricted to Incident Response Personnel • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Manager or supervisor in Quarry Managers absence • Call service provider (Quarry Manager) • Periodic inspections and update reporting of site and surrounding area (Quarry Manager)
Scale of incident	Incident would be localised to the area with minimal external impact. Impact would be visual due to smoke
Evacuate	Only if fire or explosion potential exists or staff exposed to smoke and health is of concern. Stay indoors. Quarry Manager and any advice provided by Fire Dept. as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner External mandatory: • Immediate Reporting Contact Sheet to be used

	External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service provider to advise on any clean-up or disposal aspects
Reporting and re-preparedness	See: • GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management • Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf • Review of PIRMP • Review of relevant Management plan • Reporting as per Conditions of consent • Reporting as per EPL

Incident No 11

Incident # 11	Excessive blast fume from blasts causing significant and unexpected impact to the community Actions Required: • Contractor/Visitor/Employee to notify site representative of issue immediately. (induction) • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Area to be restricted to Incident Response Personnel • If any release from site into surrounding community - Environmental Consultants to be engaged to investigate • Call service provider, Orica, to provide advice and assistance in incident
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	• Quarry Manager or supervisor in Quarry Managers absence • Call service provider (Quarry Manager) • Periodic inspections and update reporting of site and surrounding area (Quarry Manager)
Scale of incident	Incident would be localised to the area with no long term impact.
Evacuate	Only if fire or explosion potential exists or staff exposed to smoke and health is of concern. Stay indoors. Quarry Manager and any advice provided by Fire Dept. as part of attendance after immediate notification.
Communications	Internal: • Quarry Manager • Environmental Business Partner External mandatory: • Immediate Reporting Contact Sheet to be used External non-mandatory:

	Contact neighbours affected (will be dependent on wind direction). The environmental representative is to be consulted as to which neighbours will be affected by a particular wind direction.
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Waste disposal	Service provider to advise on any clean-up or disposal aspects
Reporting and re-preparedness	See: - GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management - Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf - Review of PIRMP - Review of relevant Management plan - Reporting as per Conditions of consent - Reporting as per EPL



**Building
something
great**

15. POLLUTION INCIDENT NOTIFICATION LOG

Person undertaking notification (Name/Function):			
Date and time when first become aware of the incident:			
Incident type:			
Comments:			

Initial immediate notification log				
Appropriate Regulatory Authority	Time of call	Respondent's name/function	Approximate call duration	Comments
EPA				
Public Health Unit (if relevant)				
Fire and Rescue NSW				
Local Council				
SafeWork NSW				
Other:				
Other:				
Summary of initial communication:				

Public Document

Person undertaking notification (Name/Function):		
Date and time when additional information become available:		
Comments:		

Immediate notification of further pertinent information (if applicable)				
Appropriate Regulatory Authority	Time of call	Respondent's name/function	Approximate call duration	Comments
EPA				
Public Health Unit (if relevant)				
Fire and Rescue NSW				
Local Council				
SafeWork NSW				
Other:				
Other:				
Summary of additional communication				

16. IMMEDIATE NOTIFICATION SHEET SUMMARY

Table 8 - Internal Reporting List

INTERNAL NOTIFICATIONS			
Name	Function	Phone number	Mobile number

Note: Contact details removed from online version for privacy reasons.

Table 9 - External Reporting List

Government Authority - compulsory notifications	Emergency notification phone number
EPA – Environment Line	131 555
Fire & Rescue NSW (FRNSW)	1300 729 579
Mid-Western Regional Council	1300 765 002
SafeWork NSW	131050 Company ABN asked: 51 000 187 002
Government Authority - ring if relevant	Emergency notification phone number
Public Health Unit (Greater Western) – Dubbo GW PHU (notify if potential health impacts)	HealthLink (24 hr)- 1800 063 635 Head Office- Dubbo- 6841 5569
Police & Ambulance	000
Transport for NSW (road spills)	132 701
WaterNSW	1300 662 077

Bush Fire Control Officer	1800 049 933
Poisons Information Centre	131 126
Essential Energy (power line emergencies)	13 23 91

Public Document