

Pollution Incident Response Management Plan

BERYL QUARRY

Version Thirteen: 19th June 2024



DOCUMENT CONTROL SHEET

Rev.	Date	Prepared by	Approved By	Revision Details
01	20 Aug 2012	Rod Johnson	Rod Johnson	Document Created
02	12 Dec 2012	Phillip Paterson	Rod Johnson	Document control sheet added
03	10 Apr 2013	Nathan Jeffery	Rod Johnson	Format Changes Added additional maps Added quantities of substances
04	19 Nov 2013	Nathan Jeffery	Rod Johnson	Corrected Council contact details Updated staff contact details Added Immediate Reporting Contact Sheet Update SOP reference for incident reporting Update reference map to reduce file size
05	9 Sep 2014	Rod Johnson	Rod Johnson	Updated Staff contact details
06	25 Sep 2015	Danielle Griffiths	Danielle Griffiths	Updated Staff contact details Updated risk rankings to reflect current risk matrix
07	11 Sep 2016	Danielle Griffiths	Danielle Griffiths	Updated Staff contact details Update document references to HSEQ MS
08	5 Oct 2017	Dylan Treadwell	Danielle Griffiths	Update contact details of staff Update reference to Notification Authority list Update Immediate Contact Sheet Update PIRMP Incident actions to include clean up
09	09 Mar 2020	Pere Riini	Pere Riini	Update contact details of staff
10	24 Aug 2020	Pere Riini	Pere Riini	Update contact details of staff
11	30 Mar 2021	Shoanne Labowitch	Pere Riini	Update contact details of staff Update formatting
12	20 June 2022	Sharon Makin	Ryan Stacey	Update contact details of staff Update formatting
13	21 June 2023	Chris Brown	Thomas Emerson	Update contact details of staff Update formatting
14	19 June 2024	Chris Brown	Thomas Emerson	Update contact details of staff Addition of incident #10

Table 1 Document control register

Current Rev.	Date Implemented	PIRMP Test Schedule	Date for Next Review
14	19 June 2024	12 months	19 June 2025

TABLE OF CONTENTS

PAR	T A: COMPLIANCE REQUIREMENTS, POLLUTION INVENTORIES AND RISK ASSESSMENTS	4
1.	PURPOSE	5
2.	LEGISLATIVE REQUIREMENTS	5
3.	DEFINITION OF 'POLLUTION INCIDENT'	8
4.	SCOPE	9
5.	SITE LAYOUT	10
6.	POTENTIAL POLLUTING SUBSTANCES	13
7.	ROLES AND RESPONSIBILITIES	17
8.	INTERNAL POLLUTION INCIDENT REPORTING	18
9.	EXTERNAL POLLUTION INCIDENT REPORTING	
10.	POLLUTION INCIDENT AUTHORITY CONTACT LIST	
11.	INCIDENT RESPONSE TRAINING	
12.	PIRMP TESTING	22
13.	PIRMP REVIEW	
PAR	T B: INCIDENT RESPONSE ACTIONS AND NOTIFICATION LOGS	27
14.	PIRMP RESPONSE ACTIONS	
15.	POLLUTION INCIDENT NOTIFICATION LOG	
16.	IMMEDIATE NOTIFICATION SHEET SUMMARY	47
TA	BLE OF FIGURES	
	re 1 - Beryl Quarry Location Map	
	re 2 - Beryl Quarry Reference Map	
Figu	re 3 - Beryl Quarry – Map Of Affected Areas	12
TA	BLE OF TABLES	
	le 1 Document control register	2
	le 2: Summary of Legislative Requirements of a PIRMP	
	le 3 Potential Pollutants	
	le 4 Roles and Responsibilities	
	le 5 Internal Contacts List	
	le 6 External Authorities Contact List	
	le 7 - PIRMP Drills Undertaken at Beryl Quarry	
	le 8 - Internal Reporting List	
	le 9 - External Reporting List	

PART A: COMPLIANCE REQUIREMENTS, POLLUTION INVENTORIES AND RISK ASSESSMENTS

1. PURPOSE

The purpose of the Beryl Quarry Pollution Incident Response Plan is to:

- Provide direction to the staff at Beryl Quarry in responding to pollution incidents at the Beryl operations;
- Ensure timely communication about a pollution incident is provided to staff at the premises, the Environment Protection Authority (EPA), other relevant authorities specified in the Protection of the Environment Legislation Amendment Act (POELA Act) (including Mid-Western Regional Council, NSW Ministry of Health, Work Cover NSW, and Fire and Rescue NSW) and persons outside the operations who may be affected by the impacts of a pollution incident;
- Minimise and control the risk of a pollution incident at Beryl Quarry by identifying key risks and planned actions to minimise and manage those risks;
- Detail the training requirements for this plan, identifying persons responsible for implementing it, and ensuring that the plan is regularly tested for accuracy, currency and suitability.
- A hard copy of the PIRMP is to be kept on the site environmental board in the Beryl Quarry
 Main Office. A soft copy of the PIRMP and EPL 3630 is made available online
 https://www.boral.com.au/our-commitment/environmental-reporting.

2. LEGISLATIVE REQUIREMENTS

The specific requirements for a Pollution Incident Response Management Plan (PIRMP) are set out in Part 5.7A of the POEO Act and the Protection of the Environment Operations (General) Regulation 2009 (POEO (G) Regulation). Part 3A of the POEO Act and the Protection of the Environment Operations (General) Regulation 2009 (POEO (G) Regulation) describes specific components and requirements of a PIRMP.

Table 2 summarises the location of these requirements within the document.

Table 2: Summary of Legislative Requirements of a PIRMP

Section/Clause	Requirement	Location in PIRMP
147	(1) For the purposes of this Part— (a) harm to the environment is material if— (i) it involves actual or potential harm to the health or safety of human beings or to ecosystems that is not trivial, or (ii) it results in actual or potential loss or property damage of an amount, or amounts in aggregate, exceeding \$10,000 (or such other amount as is prescribed by the regulations), and (b) loss includes the reasonable costs and expenses that would be incurred in taking all reasonable and practicable measures to prevent, mitigate or make good harm to the environment. (2) For the purposes of this Part, it does not matter that harm to the environment is caused only in the premises where the pollution incident occurs.	Section 3
153A	The holder of an environment protection licence must prepare a pollution incident response management plan that complies with this Part in relation to the activity to which the licence relates.	EPL 3630 and this document
153C	A pollution incident response management plan must be in the form required by the regulations and must include the following— (a) the procedures to be followed by the holder of the relevant environment protection licence, or the occupier of the relevant premises, in notifying a pollution incident to— (i) the owners or occupiers of premises in the vicinity of the premises to which the environment protection licence or the direction under section 153B relates, and (ii) the local authority for the area in which the premises to which the environment protection licence or the direction under section 153B relates are located and any area affected, or potentially affected, by the pollution, and (iii) any persons or authorities required to be notified by Part 5.7, (b) a detailed description of the action to be taken, immediately after a pollution incident, by the holder of the relevant environment protection licence, or the occupier of the relevant premises, to reduce or control any pollution, (c) the procedures to be followed for coordinating, with the authorities or persons that have been notified, any action taken in combating the pollution caused by the incident and, in particular, the persons through whom all communications are to be made, (d) any other matter required by the regulations.	Section 8 and 9 Section 6 Section 7, 8, 9, 10 and 14 Section 7, 8, 9, 10 and 14 Section 15 Section 7, 8, 9, 10 and 13 Section 9, 14
153D	A person who is required to prepare a pollution incident response management plan under this Part must ensure that it is kept at the premises to which the relevant environment protection licence relates, or where the relevant activity	Section 1

	I	T
	takes place, and is made available in accordance with the	
4525	regulations.	C
153E	A person who is required to prepare a pollution incident	Section 11,12
	response management plan under this Part must ensure that	
153F	it is tested in accordance with the regulations	Section 4, Section 14
1331	If a pollution incident occurs in the course of an activity so that material harm to the environment (within the meaning	3ection 4, 3ection 14
	of section 147) is caused or threatened, the person carrying	
	on the activity must immediately implement any pollution	
	incident response management plan in relation to the	
	activity required by this Part	
Part 3	BA POEO(G) Regulation 2009 Pollution Incident Response Manage	ement Plans
	note: See also 153C (a)-(c) of the POEO Act 1997	
98C(1) (a)	A description of the hazards to human health or the	Section 6, Appendix 1
	environment associated with the activity to which the licence	
	relates,	
98C(1) (b)	The likelihood of any such hazards occurring, including	Appendix 1
	details of any conditions or events that could, or would,	
	increase that likelihood,	
98C(1) (c)	Details of the pre-emptive action to be taken to minimise or	Section 9, Appendix 1,
	prevent any risk of harm to human health or the	Section 14
	environment arising out of the relevant activity	
98C(1) (d)	An inventory of potential pollutants on the premises or used	Section 6
/-> /6>	in carrying out the relevant activity	
98C(1) (f)	A description of the safety equipment or other devices that	Section 6, Appendix 1
	are used to minimise the risks to human health or the	
000(4) (-)	environment and to contain or control a pollution incident,	C+i 0.4C
98C(1) (g)	the names, positions and 24-hour contact details of those	Section 8 16
	key individuals who:	
	I. are responsible for activating the plan, and	
	II. are authorised to notify relevant authorities under	
	section 148 of the Act, and	
	III. are responsible for managing the response to a	
	pollution incident,	
98C(1) (h)	the contact details of each relevant authority referred to in	Section 9, 16
, , , , ,	section 148 of the Act,	
98C(1) (i)	Details of the mechanisms for providing early warnings and	Section 10
	regular updates to the owners and occupiers of premises in	
	the vicinity of the premises to which the licence relates or	
	where the scheduled activity is carried on	
98C(1) (j)	The arrangements for minimising the risk of harm to any	Section 9, Appendix 1
	persons who are on the premises or who are present where	
	the scheduled activity is being carried on	
98C(1) (k)	A detailed map (or set of maps) showing the location of the	Section 5
	premises to which the licence relates, the surrounding area	
	that is likely to be affected by a pollution incident, the	
	location of potential pollutants on the premises and the	
	location of any stormwater drains on the premises	
98C(1) (I)	A detailed description of how any identified risk of harm to	Section 9, Appendix 1
	human health will be reduced, including (as a minimum) by	
	means of early warnings, updates and the action to be taken	
	during or immediately after a pollution incident to reduce	
	that risk,	

98C(1) (m)	The nature and objectives of any staff training program in	Section 11
	relation to the plan	
98C(1) (n)	The dates on which the plan has been tested and the name	Table 7
	of the person who carried out the test,	
98C(1) (o)	The dates on which the plan is updated,	Document Control
		Sheet
98C(1) (p)	The manner in which the plan is to be tested and maintained.	Section 11, 12, 13

3. DEFINITION OF 'POLLUTION INCIDENT'

The definition of a pollution incident is:

"pollution incident means an incident or set of circumstances during or as a consequence of which there is or is likely to be a leak, spill or other escape or deposit of a substance, as a result of which pollution has occurred, is occurring or is likely to occur. It includes an incident or set of circumstances in which a substance has been placed or disposed of on premises, but it does not include an incident or set of circumstances involving only the emission of any noise."

A pollution incident is required to be notified if there is a risk of 'material harm to the environment', which is defined in section 147 of the POEO Act as:

- a) harm to the environment is material if:
 - i. it involves actual or potential harm to the health or safety of human beings or to ecosystems that is not trivial, or
 - ii. it results in actual or potential loss or property damage of an amount, or amounts in aggregate, exceeding \$10,000 (or such other amount as is prescribed by the regulations), and
- b) loss includes the reasonable costs and expenses that would be incurred in taking all reasonable and practicable measures to prevent, mitigate or make good harm to the environment.

Beryl Quarry is now required to report non-trivial pollution incidents immediately to the EPA, NSW Health, Fire and Rescue NSW, WorkCover NSW and the local council.

Beryl Quarry – PIRMP-V14

4. SCOPE

This PIRMP must be followed by employees, contractors and visitors of Beryl Quarry, to assist in the early response to and reporting of a pollution incident.



5. SITE LAYOUT

Figure 1 - Beryl Quarry Location Map



Figure 2 - Beryl Quarry Reference Map

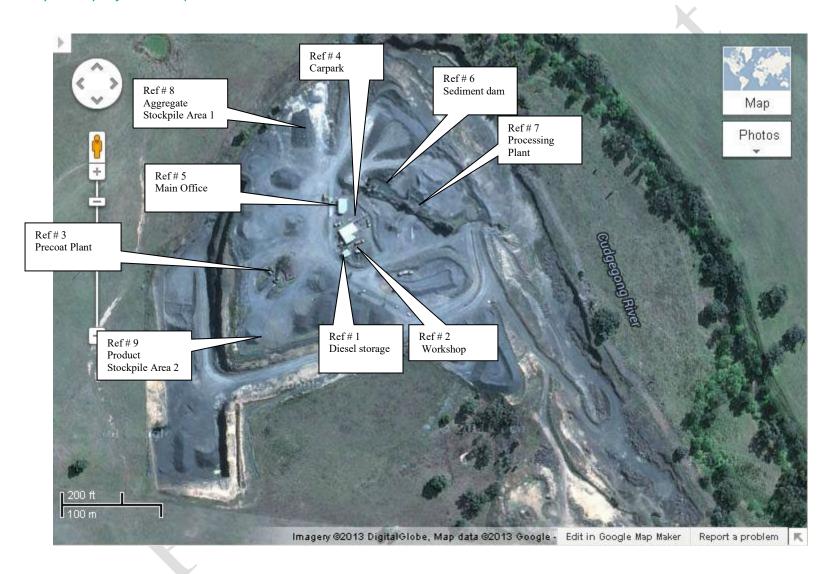


Figure 3 - Beryl Quarry – Map Of Affected Areas



6. POTENTIAL POLLUTING SUBSTANCES

Table 3 below is an inventory of potential pollutants kept on the premises. This inventory provides a description of the main hazards to human health or the environment, an assessment of the likelihood of the hazards occurring and also includes the current controls and safety equipment and/ or pre-emptive actions in place to minimise or prevent risk of harm to human health or the environment.

Table 3 Potential Pollutants

Site Name:						Responsible Person:	Date:
Beryl Quarry Name /	Covered under	Amount	Location of	Мар	Need for	Quarry Manager Current controls	19/06/2024 See Risk Ass & PIRMP
description	Haz Chemicals/MSDS?	stored	storage	reference	early warning ¹		Response Action (see Below)
CHEMICALS/FUI	ELS/LUBRICANTS (raw n	naterials and	products which	can cause po			,
Diesel	Class 3	10 000 ltrs	Diesel Storage Area	Ref No #1	N/A	 Bunding PMP Training Spill Kits SOP Inductions Fire Fighting Equipment Security 	Incident #1-2, 11
Precoat	Class 3	22 000ltrs	Precoat Storage Area	Ref No #3	N/A	 Bunding PMP Training Spill Kits SOP Inductions Fire Fighting Equipment Security 	Incident #1-3, 11
Oils/Solvents	Class 3	Packaged goods up to 600ltrs	Oil Storage Shed at Workshop	Ref No [#] 2	N/A	BundingPMPTraining	Incident [#] 4, 11

¹ Early warnings relate to informing neighbours who may be affected by the emission of this substance. If this substance is of a type and quantity which may reach neighbours then early warning assessment of actions is required to be undertaken.

						•	Flammable Cabinet Spill Kits Inductions Fire Fighting Equipment Security	
Lubricants, Gases	Class 2	Variable	Maintenance Workshop	Ref No #2	N/A	•	Fire Extinguishers Concrete Floor Enclosed Shed Containment Cages and Cabinets	Incident #4, 11
Oils/Fuel	Class 3	Variable	Plant and Equipment (Workshop area)	Ref No #2	N/A	•	PMP Training Spill Kits SOP Inductions Fire Fighting Equipment Security	Incident #4, 11
Product Stockpiles	ockpiles, silos, bulk so N/A	Variable	Dedicated on site	Ref No #8 & #9	N/A	•	Water sprays Water Cart Maintain manageable levels Security	Incident #5
Water Storage Dam (Sediment)	ns, wastewater tanks	Variable	storage area)	Ref No #6	N/A	•	Continue to use for dust suppression Ensure pumps are maintained through scheduled	Incident #6

Beryl Quarry – PIRMP-V14 15 of 48

Storm Water Drains	N/A	Variable	Site	N/A	N/A	maintenance Discharge monitoring Straw Bales Rubber and Earthen Berms Audits and Inspections	Incident #6
						tment plants, vehicles etc)	1
Name / description	Covered under Haz Chemicals/MSDS	Amount stored	Location of storage	Map reference	Need for early warning ²	Current controls	See Risk Ass & PIRMP Response Action (see Below)
Mobile Plant (onsite) BORAL	Class 3	Up to 10 MP on site	Dedicated on site	N/A	N/A	Spill KitsPre start checksPMPTraining	Incident #7
Mobile Plant Contractor/visitor	Class 3	Variable	Variable Locations	N/A	N/A	Spill KitsTrainingInductions	Incident #8
Car Parking up to 20 vehicles	Class 3	Variable	Site Office	Ref No #4	N/A	Spill KitsTraining	Incident #9
Traffic Areas (dust, chem. leaks & loss	Class 3	N/A	Dedicated on site	N/A	N/A	TrainingWater cartSpill Kits	Incident #10

² Early warnings relate to informing neighbours who may be affected by the emission of this substance. If this substance is of a type and quantity which may reach neighbours then early warning assessment of actions is required to be undertaken.

7. ROLES AND RESPONSIBILITIES

Table 4 Roles and Responsibilities

Position	Responsibility
Employees and Contractors	Following the procedures outlined in the PIRMP and related documents
	Immediately alerting Supervisor or Team Leader of any environmental incidents or near-misses.
Team Leaders / Front Line Supervisors	Following the procedures outlined in the PIRMP and related documents
	Immediately alerting Site/Quarry Manager or, in case of their unavailability, Environmental Representative or Environment Manager of any potentially material environmental incidents or near-misses. Conducting incident investigations.
Site / Operations Manager and/or Site Environmental	Authorisation of the PIRMP Administration, maintenance and implementation of the PIRMP
Coordinator and/or Environment Manager	Assessing whether the incident has caused or threatens "material environmental harm" and, if so, immediately notifying all Appropriate Regulatory Authorities. Ensuring that investigations are undertaken to a level corresponding to the level of risk and impact.
HSE Regional Manager and/or Regional Environment	Make a determination as to whether the incident (as defined in section 147 of the POEO Act) is non-trivial and therefore reportable to external agencies
Manager	Inform Executive General manager and Group management of Notification to External Agencies
	Undertake notifications as defined in PIRMP
	Authorise notifications to public and/or media following GRP-HSEQ-2-02

8. INTERNAL POLLUTION INCIDENT REPORTING

Any pollution incident satisfying the *material harm* threshold must be immediately reported to relevant statutory authorities by either the Site/Operations Manager, or Environment Manager.

In cases where material harm level cannot be immediately assessed or insufficient information comes to hand on the severity of the incident, the general advice is to err on the side of caution and notify the Relevant Authorities with a qualification that the situation could not yet be fully assessed.

Until further notice the following procedure needs to be followed:

- 1. When a pollution incident occurs, a person who has become aware of it must immediately bring it to the attention of his/her immediate Supervisor or Manager
- 2. If necessary, first ring 000 for Emergency Services
- 3 At least one of the following BCM personnel must be contacted **immediately**:

Table 5 Internal Contacts List

Name	Function	Phone number	Mobile number
	4.4		
^			

Note: Contact details removed from online version for privacy reasons.

- 4. The quarry manager, or in case of his unavailability one of the Senior Management personnel listed above, is to **immediately** notify all Appropriate Regulatory Authorities specified in Section 9.
- 5. In borderline situations, where the exceedance of the trigger level of "material harm" of a pollution incident may not be clear, a quick assessment including consultation with Boral environmental personnel should be undertaken to help the decision whether to notify or not.

6. Boral's Senior Management must be informed promptly of the fact of immediate notification to the Authorities. This includes environmental personnel listed above, as well as Rod Wallace, David Simpson, David Bolton, Scott Carter and Greg Price.

9. EXTERNAL POLLUTION INCIDENT REPORTING

As the legislation requires that notification must be done immediately upon becoming aware of the pollution incident, it is unlikely that a detailed picture will be available for reporting. Notwithstanding, is seems that some of the Government Authorities prepared a detailed questionnaire which is being filled at the time of this initial notification. Under the stress of incident handling it could be easy to provide a hasty, inaccurate estimate of the situation when answering these questions.

Therefore, the notification should be restricted to the facts known and nothing should be assumed or guessed. The details will be provided to the asking Authority later when more information comes to hand.

The initial notification should include as much of the following information (if known) as possible:

- location and time of the pollution incident
- type of the incident (spill, fire, unlicensed harmful discharge, etc)
- assessed level of incident gravity: "it seems to be..." (e.g. "a relatively minor spill"; "major fire", "explosion limited to one building", etc.)
- whether the Emergency Services have been required to attend.

Unless known for a fact, the answers to other questions should be politely deferred until a better assessment of the situation can be made.

The Boral person who is responsible for notifying the Authorities (NSW HSE Regional Manager or Senior Environmental Business Partner) about the incident must prepare a Notification Log (a suitable form is attached) with the details of time of notifications and the persons who took to the call. The Authorities will generally provide an Incident Notification Number.

Notification of all Appropriate Government Authorities (at least 5 entities) may take considerable time. Delays may be experienced connecting to the right person or no contact may be possible after hours. All such instances should be recorded in the Notification Log.

10. POLLUTION INCIDENT AUTHORITY CONTACT LIST

Table 6 External Authorities Contact List

Government Authority - compulsory notifications	Emergency notification phone number
EPA – Environment Line	131 555
Fire & Rescue NSW (FRNSW)	1300 729 579
Mid-Western Regional Council	1300 765 002
Public Health Unit (Greater Western) – Dubbo GW PHU	HealthLink (24 hr)- 1800 063 635 Head Office- Dubbo- 6841 5569
WorkCover Authority of NSW	131050 Company ABN asked: 51 000 187 002
Government Authority - ring if relevant	Emergency notification phone number
Police & Ambulance	000
Roads and Maritime Services (road spills)	
Rodus and Maritime Services (rodu spins)	132 701
NSW Office of Water	132 701 8838 7885
NSW Office of Water	8838 7885

Communication with the local community may also be undertaken depending on the circumstances of the pollution incident. Beryl Quarry would consider the following options for providing Early Warning and ongoing information to the community on pollution incidents:

- Direct phone contact with any local residents directly impacted by the pollution incident
- Letter Box drops of incident information and site contacts to local residents impacted by the pollution incident

The Stakeholder Relations Manager can assist in the process of communicating with the community, as per the Stakeholder Engagement Plan for the site.

11. INCIDENT RESPONSE TRAINING

Beryl Quarry will implement the Pollution Incident Response Management Plan by training or providing information to relevant employees and contractors in relevant areas of the Plan.

The nature and objectives of staff training is to relate to site personnel the importance of early notification of any incidents and spills to site supervisors and key personnel.

Training or information will be provided on the following;

- The contents and intent of this PIRMP,
- The roles and responsibilities of site staff in relation to this PIRMP
- Spill response procedures;
- General environmental awareness; and / or
- Hazardous materials awareness.

Site inductions for visitors and sub-contractors also advise individuals to report any environmental incidents or spills to site supervisors and key personnel immediately. Key site personnel and supervisors participate in PIRMP Tests which are used as practical training and can also be used to identify any potential gaps or areas for improvement for the PIRMP. A summary of the PIRMP Drills undertaken at Beryl Quarry is shown below in Table 7.

Table 7 - PIRMP Drills Undertaken at Beryl Quarry

Test Date	Version tested	Incident Drilled	Drill Team Lead
March 2020	10	Desktop review of document	Shoanne Labowitch
June 2022	11	Desktop review of document	Sharon Makin
June 2023	12	Desktop review of document	Chris Brown

			_
1000 2021	1 12	Oil drum fire	Thomas Emerson
Julie 2024	1 13	Oil drum tire	l Inomas Emerson

A sign-off sheet is kept of the personnel present for the undertaking of a PIRMP Drill and a record is kept on when and how the PIRMP is communicated to employees. This information forms a section of the PIRMP Drill document. For more information regarding each of the PIRMP Drills, refer to the specific drill document.

12. PIRMP TESTING

Plans must be tested routinely at least once every 12 months. The testing is to be carried out in such a manner as to ensure that the information included in the plan is accurate and up to date, and that each plan is capable of being implemented in a workable and effective manner.

The objectives of an audit are to maintain compliance with this plan. Internal audits of this Plan will be undertaken every 3 years.

Routine testing of the PIRMP will be conducted annually, and can be completed through the following methods:

- Simulated environmental emergency; or
- Desktop simulations.

13. PIRMP REVIEW

Revisions are to be coordinated by the Site Manager and Environmental Representative.

The objectives of a review are:

- To maintain compliance with the statutory requirements, and
- To identify opportunities for improvement in the Plan, and reduce the risk to human health and the environment

13.1. EVENT BASED

Events which may trigger a review of this Plan or its associated documents include:

- Within 1 month of reporting to the nominated parties in accordance with the plan, after a pollution incident, or
- Modification/Improvement to the system

13 .2. TIME BASED

Beryl Quarry will review this management plan routinely every 12 months. The Plan review will include:

- This Document, and
- Legislation, Approval and Licence changes.

APPENDIX 1.

RISK ASSESSMENT on POTENTIAL IMPACTS

Hazard and Likelihood Risk Assessment and Corrective Control Measures Site: Responsible Person: **Reviewed Date:** 19/06/2024 Quarry Manager/Supervisor **Beryl Quarry** Name / ref of **Description of Control Measures** pollutant/ Conseq Likely Impact on Responsible Action Risk Hazard / Incident **Corrective Action** neighbours³ chemicals uence hood person date leading to hazard **Coverage under other Plans** Incident #1 N/A Consequence: (minor): Failure resulting in loss of all or substantial volume of Diesel 2 1 When As per tanks would be captured entirely by existing primary bund with no release to **PIRMP** Catastrophic failure required of one/both above soil or water. action plan ground tanks Likelihood: (unlikely): Tanks is a double walled self bunded storage tank. Due to location of tank damage to tanks is unlikely to occur from external equipment. In addition tanks are maintained in good structural integrity with low risk of failure through corrosion. Incident #2 2 2 Consequence: (minor): Failure resulting in loss/leakage from fuelling or re-When N/A As per Loss of diesel fuelling from hose, nozzle or plant/equipment would be captured by a self **PIRMP** required outside bund during bunded fill point or spill kill with minimal release to soil. action plan refuelling/fuelling Likelihood: (unlikely): Due to location within the tank structure an incident operations. while re-fuelling and fuelling is likely to occur on some occasions. Hoses and refuelling equipment are maintained with low risk of failure. Oils/Solvents Incident #3 1 N/A When Consequence: (incidental): Failure resulting in loss of oils/solvents from As per **PIRMP** Loss of oils solvents packaged goods would be captured entirely by existing primary bund with no required inside bund during release to soil or water. action plan delivery and or use Likelihood: (unlikely): Due to location within the bund, spillage during delivery and use is unlikely to occur. In addition hoses and decanting

Beryl Quarry – PIRMP-V14 24 of 48

equipment are maintained in good structural integrity with low risk of failure.

³ If the incident may impact on neighbours then it will need to trigger the early warnings assessment and actions

Product stockpiles	Incident #4. Excessive airborne dust from stockpiled	1	2	L	Y	Consequence: (incidental): Excessive dust from stockpile during high winds causing nuisance to surrounding area.	As per PIRMP action plan	When required
	material					Likelihood: (unlikely): Stockpiles are maintained to a manageable level on a monthly basis. Use of water sprinklers and water cart onsite during windy periods.		
Sediment Dams	Incident #5 Catastrophic failure of one or more sediment dams releasing large volumes of water into on-site and off- site water courses (i.e creek).	1	2	L	N/A	Consequence: (incidental): Catastrophic failure of one or more sediment dams are likely to result in off-site impacts to water courses which would predominantly reduce water quality over a short period of time. As such, impact to the environment/human health is not considered to be significant. Likelihood: (unlikely): Dams are frequently monitored and inspected for levels and integrity. Note: For PIRMP purposes overflow events during extreme wet weather will	As per PIRMP action plan	When required
	,					be reported under POEO Licence obligations and not Immediate Reporting.		
Mobile Plant	Incident #6 Mobile plant, hydraulic hose or fuel tank failure	1	2	L	N	Consequence: (incidental): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site. Likelihood: (unlikely): Hose or fuel tank failure from mobile plant would be minimal as prestart and regular maintenance programs are in place to capture and prevent such occurrences. Spills kits also maintain and available in various areas.	As per PIRMP action plan	When required
Mobile plant/ Contractor, Visitor	Incident #7 Mobile plant, hydraulic hose or fuel tank failure	1	2	L	N	Consequence: (incidental): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site. Likelihood: (unlikely): Hose or fuel tank failure from mobile plant would be minimal as prestart and regular maintenance programs are in place to capture and prevent such occurrences. Spills kits also maintain and available in various areas. Inductions for all contractors demonstrating their accountabilities and responsibilities for reporting environmental incidents.	As per PIRMP action plan	When required
Car Park	Incident #8 Ruptured fuel tank	1	2	L	N	Consequence: (incidental): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site. Likelihood: (unlikely): Hose or fuel tank failure from employee or visitor car would be minimal. Car park area is fully sealed. Spill kits also maintain and available in various areas	As per PIRMP action plan	When required

Beryl Quarry – PIRMP-V14 25 of 48

Traffic areas (dust)	Incident # 9 Surface dust from mobile plant	1	2	L	Y	Consequence: (incidental): Dust created form continuous mobile plant operations across site Likelihood: (unlikely): Main areas watered with water cart in high wind conditions	As per PIRMP action plan	When required
Smoke	Incident #10 Excessive smoke as a result of infrastructure or equipment fire causing significant and unexpected impact to the community	1	1	L	Y.	Consequence: (minor) smoke would be visible but due to distance to the nearest receivers would have little impact Likelihood: (unlikely) fire fighting controls are in place in the operations and staff have been trained in fire fighting response. Maintenance schedule in place to ensure process and fire fighting equipment are in good working order. Emergency response training for Boral staff in place including fire response. Windy conditions will increase potential for smoke to leave site	As per PIRMP action plan	When required

Beryl Quarry – PIRMP-V14 26 of 48

PART B: INCIDENT RESPONSE ACTIONS AND NOTIFICATION LOGS



14. PIRMP RESPONSE ACTIONS

Incident No 1

Incident #1	Catastrophic failure of one/both diesel tanks. Actions Required:
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)
	Ensure bunds are capturing full volume of diesel
	 Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)
	Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents
	Area to be restricted to Incident Response Personnel
	Ensure spill kit available for any release from bund
	 If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate
	contamination.
	Repair/replace tanks
	Refuel tanks
	Inspect bund for ongoing serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency	Quarry Supervisor Call and its proposition (Supervisor)
Controller	Call service provider (Supervisor) Call Vite and a service provider (Supervisor)
	Spill Kit manager (Supervisor) Paris the insuration and an electrometric of site and bound (Supervisor)
6 1 6: :1 :	Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be restricted to Diesel/Precoat storage area with minimal external impact, however, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.
Communications	Internal:
	Quarry Manager
	Enviro Representative - Rod Johnson &/or Sharon Makin
	External mandatory:
	Immediate Reporting Contact Sheet to be used
	External non-mandatory: N/A
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
respondent +	
safety checks	, and the second

Beryl Quarry – PIRMP-V14 28 of 48

Rescue + First	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Aid	
Clean up and	Service Provider to dispose of diesel and advise on required clean-up.
Waste disposal	
Reporting and	Incident Notification (GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management)
re-preparedness	

Incident No 2

Actions Required: Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) Ensure bund are capturing full volume of diesel Ensure bund Integrity is sound throughout the entire period of incident (i.e. periodic inspections) Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents Area to be restricted to Incident Response Personnel Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Refuel tanks Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Call service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Liternal: Quarry Supervisor Communications As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		
Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) Ensure bunds are capturing full volume of diesel Sinsure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents Area to be restricted to Incident Response Personnel Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Controller Quarry Supervisor Controller Incident would be restricted to Diese/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Outer	Incident #2	Loss of Fuel due to filling and refueling from one/both diesel tanks.
Ensure bunds are capturing full volume of diesel Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) Contact service provider (clatex No. 180003311 or Transpacific 02 96007185) to pump-out bund contents Area to be restricted to incident Response Personnel Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Inspect bund for ongoing serviceability Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Call service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting secialist investigation/remediation. Communications Communications Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		
Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections) Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents Area to be restricted to Incident Response Personnel Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Call service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update re		
Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents Area to be restricted to incident Response Personnel Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Periodic inspections of Controller Spill kit manager (Supervisor) Scale of incident may result in soil and surface water contamination that will require specialist investigation/remediation. Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update are contamination that will require specialist investigation/remediation. Communications Internal: Lequarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Internal mandatory External mandatory External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		
Area to be restricted to Incident Response Personnel Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Call service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic mestricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Communications Internal: Quarry Manager Cuurry Manager Courry Manager Courry Manager Courry Manager Courry Representative - Greg Johnson &/or Chris Brown External mandatory: N/A Rescuer / respondent + safety checks As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		 Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)
Ensure spill kit available for any release from bund If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Pull service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Feacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescuer / Frespondent As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		 Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents
If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Call service provider (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Scale of incident Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescuer + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Area to be restricted to Incident Response Personnel
contamination. Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Coll service provider (Supervisor) Spill kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Periodic inspections to be implemented. Emergency Periodic inspections to be implemented. Periodic inspe		Ensure spill kit available for any release from bund
Rescuer / Rescue		If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate
Refuel tanks Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Outroller Scale of incident Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory External mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		contamination.
Inspect bund for ongoing serviceability Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. Emergency Controller Call service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Communications Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting Rescuer / respondent + safety checks Rescue + First Aid		Repair/replace tanks
Alarm raising Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented. • Quarry Supervisor • Call service provider (Supervisor) • Spill Kit manager (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor) • Periodic inspections and update reporting of site and bund (Supervisor) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: • Quarry Manager • Enviro Representative - Greg Johnson &/or Chris Brown • External mandatory • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting Rescuer / respondent + safety checks Rescuer + First Aid		Refuel tanks
Emergency Controller Ouarry Supervisor Call service provider (Supervisor) Scale of incident Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Ouarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Inspect bund for ongoing serviceability
Controller Call service provider (Supervisor) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Communications Communications Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Supervisor) Scale of incident Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Communications Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Emergency	Quarry Supervisor
Periodic inspections and update reporting of site and bund (Supervisor) Scale of incident Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Controller	Call service provider (Supervisor)
Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation. Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal:		Spill Kit manager (Supervisor)
may result in soil and surface water contamination that will require specialist investigation/remediation. Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification. Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As part of Immediate Reporting As part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Periodic inspections and update reporting of site and bund (Supervisor)
Communications Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Scale of incident	Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure
notification. Communications Internal:		may result in soil and surface water contamination that will require specialist investigation/remediation.
Communications Internal: Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate
 Quarry Manager Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		notification.
 Enviro Representative - Greg Johnson &/or Chris Brown External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Communications	Internal:
 External mandatory Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Quarry Manager
• Immediate Reporting Contact Sheet to be used External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Enviro Representative - Greg Johnson &/or Chris Brown
External non-mandatory: N/A Rescuer / respondent + safety checks Rescue + First Aid External non-mandatory: N/A As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		External mandatory
Rescuer / respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Immediate Reporting Contact Sheet to be used
respondent + safety checks Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting		External non-mandatory: N/A
Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting	respondent +	
Rescue + First Aid As per Site Emergency Plan or Fire Department as part of Immediate Reporting	safety checks	
Aid	•	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and Service Provider to dispose of diesel and advise on required clean-up.	Aid	
	Clean up and	Service Provider to dispose of diesel and advise on required clean-up.

Beryl Quarry – PIRMP-V14 30 of 48

Waste disposal	
Reporting and	See:
re-preparedness	GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management
	 Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf Review of PIRMP Review of relevant Management plan Reporting as per Conditions of consent Reporting as per EPL

Beryl Quarry – PIRMP-V14 31 of 48

Incident No 3

Incident #3	Loss off oil/solvents, packaged goods.
	Actions Required:
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)
	Ensure bunds are capturing full volume of oil/solvents
	Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)
	 Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents
	Area to be restricted to Incident Response Personnel
	Ensure spill kit available for any release from bund
	If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate
	contamination.
	Inspect bund for ongoing serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency	Quarry Supervisor
Controller	Call service provider (Supervisor)
	Spill Kit manager (Supervisor)
	Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be restricted to chemical storage area with minimal external impact. However, potential for bund overflow or failure may
	result in soil and surface water contamination that will require specialist investigation/remediation.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate
	notification.
Communications	Internal:
	Quarry Supervisor
	Enviro Representative - Greg Johnson &/or Chris Brown
	External mandatory
	Immediate Reporting Contact Sheet to be used
	External non-mandatory: N/A
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
respondent +	
safety checks	
Rescue + FirstAid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Clean up and	Service Provider to dispose of diesel, oil, grease and advise on required clean-up.
Waste disposal	
Reporting and	See:
re-preparedness	GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management

Beryl Quarry – PIRMP-V14 32 of 48

Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf
Review of PIRMP
Review of relevant Management plan
Reporting as per Conditions of consent
Reporting as per EPL

Incident No 4

Incident #4	Excessive airborne dust from stockpiled material.
	Actions Required:
	Employees, Contractor/Visitor to notify site representative of issue immediately. (induction)
	Daily monitoring to be undertaken to assess weather and site conditions
	 Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)
	Dust suppression activity to commence immediately on stockpiles
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency	Quarry Supervisor
Controller	Call service provider (Supervisor)
	Spill Kit manager (Supervisor)
	 Periodic inspections and update reporting of site and bund (Supervisor)
Scale of incident	Incident would be localised to the area surrounding stockpile area, with minimal external impact.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate
	notification.
Communications	Internal:
	Quarry Manager
	Enviro Representative - Greg Johnson &/or Chris Brown
	External mandatory
	Immediate Reporting Contact Sheet to be used
	External non-mandatory: N/A
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
respondent +	
safety checks	
Rescue + First	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Aid	
Clean up and	Service Provider to dispose of diesel and advise on required clean-up.
Waste disposal	

Beryl Quarry – PIRMP-V14 33 of 48

Reporting and re-preparedness GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf Review of PIRMP Review of relevant Management plan Reporting as per Conditions of consent Reporting as per EPL

Beryl Quarry – PIRMP-V14 34 of 48

Incident No 5

Incident #5	Failure of one or more sediment dams.			
	Actions Required:			
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)			
	Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)			
	Contact local neighbours if going to be in inundated by rise of water			
	Area to be restricted to Incident Response Personnel			
	If any release from site onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination if any			
	Contact local contractor to rebuild dams immediately			
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.			
Emergency	Quarry Supervisor			
Controller	Call service provider (Supervisor)			
	Spill Kit manager (Supervisor)			
	Periodic inspections and update reporting of site and bund (Supervisor)			
Scale of incident	Catastrophic failure of one or more sediment dams are likely to result in off-site impacts to water courses which would predominantly reduce water quality over a short period of time. As such, impact to the environment/human health is not considered to be significant.			
Fugguete	Only if flood potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.			
Evacuate				
Communications	Internal:			
	Quarry Manager Special Research title			
	Enviro Representative - Greg Johnson &/or Chris Brown			
	External mandatory			
	Immediate Reporting Contact Sheet to be used Standard St			
D /	External non-mandatory: N/A			
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
respondent +				
safety checks				
Rescue + First	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
Aid				
Clean up and	Consultants to be contacted to advise on required clean-up.			
Waste disposal				
Reporting and	See:			
re-preparedness	GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management			
	Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf			

Beryl Quarry – PIRMP-V14 35 of 48

- Review of PIRMP
- Review of relevant Management plan
- Reporting as per Conditions of consent
- Reporting as per EPL

Beryl Quarry – PIRMP-V14 36 of 48

Incident #6	Mobile plant, hydraulic hose or fuel tank failure.			
meident o	Actions Required:			
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)			
	Area to be restricted to Incident Response Personnel			
	Ensure spill kit available for any release from mobile plant & equipment			
	Used spill kit absorbent pads to be stored in designated spill bags for correct disposal			
	If any release from mobile plant onto unsealed soil/surface water is investigated and remediated immediately			
	Call service provider to inspect plant & equipment for serviceability			
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.			
Emergency	Quarry Supervisor			
Controller	Call service provider (Supervisor)			
	Spill Kit manager (Supervisor)			
	Periodic inspections and update reporting of site and bund (Quarry Supervisor)			
Scale of incident	Incident would be localised to the area with no external impact.			
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate			
	notification.			
Communications	Internal:			
	Quarry Manager			
	Enviro Representative - Greg Johnson &/or Chris Brown			
	External mandatory			
	Immediate Reporting Contact Sheet to be used			
	External non-mandatory: N/A			
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
respondent +				
safety checks				
Rescue + First	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
Aid				
Clean up and	Service Provider to dispose of diesel and advise on required clean-up.			
Waste disposal				
Reporting and	See:			
re-preparedness	GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management			
	Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf			

Beryl Quarry – PIRMP-V14 37 of 48

- Review of PIRMP
- Review of relevant Management plan
- Reporting as per Conditions of consent
- Reporting as per EPL

Beryl Quarry – PIRMP-V14 38 of 48

Incident #7	Mobile plant, hydraulic hose or fuel tank failure from contractors / visitors.			
	Actions Required:			
	Contractor/Visitor to notify site representative of issue immediately. (induction)			
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)			
	Area to be restricted to Incident Response Personnel			
	Ensure spill kit available for any release from mobile plant & equipment			
	Used spill kit absorbent pads to be stored in designated spill bags for correct disposal			
	If any release from mobile plant onto unsealed soil/surface water is investigated and remediated immediately			
	Call service provider to inspect plant & equipment for serviceability			
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.			
Emergency	Quarry Supervisor			
Controller	Call service provider (Supervisor)			
	Spill Kit manager (Supervisor)			
	Periodic inspections and update reporting of site and bund (Supervisor)			
Scale of incident	Incident would be localised to the area with no external impact.			
Evacuate	Only if fire or explosion potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate			
	notification.			
Communications	Internal:			
	Quarry Manager			
	Enviro Representative - Greg Johnson &/or Chris Brown			
	External mandatory			
	Immediate Reporting Contact Sheet to be used			
	External non-mandatory: N/A			
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
respondent +				
safety checks				
Rescue + First	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
Aid				
Clean up and	Service Provider to dispose of contaminates.			
Waste disposal				
Reporting and	See:			
re-preparedness	GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management			
	 Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf 			

Beryl Quarry – PIRMP-V14 39 of 48

- Review of PIRMP
- Review of relevant Management plan
- Reporting as per Conditions of consent
- Reporting as per EPL

Beryl Quarry – PIRMP-V14 40 of 48

Incident #8	Car Park/ fuel tank failure.				
	Actions Required:				
	Contractor/Visitor to notify site representative of issue immediately. (induction)				
	Area to be restricted to Incident Response Personnel				
	Ensure spill kit available for any release from mobile plant If any release from mobile plant onto unsealed spil/surface water is investigated and remediated immediately.				
	If any release from mobile plant onto unsealed soil/surface water is investigated and remediated immediately				
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.				
Emergency	Quarry Supervisor				
Controller	Spill Kit manager (Supervisor)				
Scale of incident	Incident would be localised to the area with no external impact.				
Evacuate	Only if fire or explosion potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate notification.				
Communications	Internal:				
Communications	Quarry Manager				
	Enviro Representative - Greg Johnson &/or Chris Brown				
	External mandatory				
	Immediate Reporting Contact Sheet to be used				
	External non-mandatory: N/A				
Rescuer /	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
respondent +					
safety checks	Y Control of the cont				
Rescue + First	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Aid					
Clean up and	Service Provider to dispose of contaminate				
Waste disposal					
Reporting and	See:				
re-preparedness	GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management				
	 Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf 				
	Review of PIRMP				
	Review of relevant Management plan				
	Reporting as per Conditions of consent				
	Reporting as per EPL				

Beryl Quarry – PIRMP-V14 41 of 48

Incident #9	Dust from traffic areas. Actions Required: • Employees, Contractor/Visitor to notify site representative of issue immediately. (induction) • Daily monitoring to be undertaken to capture whether and site conditions • Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) • Dust suppression activity to commence immediately on unsealed roads & dusty areas of site			
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.			
Emergency Controller	 Quarry Supervisor Quarry Supervisor to instruct site personnel 			
Scale of incident	Incident would be localised to the area with minimal external impact.			
Evacuate	Only if fire or potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate notification.			
Communications	Internal:			
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting			
Clean up and Waste disposal	N/A			
Reporting and re-preparedness	See: GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf Review of PIRMP Review of relevant Management plan Reporting as per Conditions of consent Reporting as per EPL			

Beryl Quarry – PIRMP-V14 42 of 48

Incident #10	Excessive smoke as a result of infrastructure or equipment fire causing significant and unexpected impact to the community Actions Required:		
	 Employees, Contractors/Visitor to notify site representative of issue immediately. (induction) Emergency response plan to be activated as necessary including firefighting if possible or calling Emergency Services Area to be restricted to Incident Response Personnel Contact all relevant people/department (refer to Immediate Reporting Contact Sheet) 		
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.		
Emergency Controller	 Quarry Manager or supervisor in Quarry Managers absence Call service provider (Quarry Manager) Periodic inspections and update reporting of site and surrounding area (Quarry Manager) 		
Scale of incident	Incident would be localised to the area with minimal external impact. Impact would be visual due to smoke		
Evacuate	Only if fire or explosion potential exists or staff exposed to smoke and health is of concern. Stay indoors. Quarry Manager and any advice provided by Fire Dept. as part of attendance after immediate notification.		
Communications	Internal:		
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting		
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting		
Clean up and Waste disposal	Service provider to advise on any clean-up or disposal aspects		

Beryl Quarry – PIRMP-V14 43 of 48

Reporting and re-preparedness See: GRP-HSEQ-3-02 Incident Reporting Investigation and Action Management Incident Notification SOP GRP-HSEQ-3-02Incident_Reporting_Investigation_and_Action_Management v3.2.pdf Review of PIRMP Review of relevant Management plan Reporting as per Conditions of consent Reporting as per EPL

Beryl Quarry – PIRMP-V14 44 of 48

15. POLLUTION INCIDENT NOTIFICATION LOG

Person undertaking (Name/Function):	notification				
Date and time when incident:	first become aw	are of the			
Incident type:					
Comments:					
					7,7
Initial immediate no	tification log				
Appropriate Regulatory Authority	Time of call	Responde name/fun		Approximate call duration	Comments
EPA					
Public Health Unit					
Fire and Rescue NSW					
Local Council					
WorkCover					
Other:		, ,			
Other:	·				
Summary of initial communication:					

Danisa un dantalia a		/F + i).		
Person undertaking	<u> </u>	· · · · · · · · · · · · · · · · · · ·		
Date and time when available:	additional infori	mation become		
Comments:				
			/·c	
Immediate notificat	1			
Appropriate Regulatory Authority	Time of call	Respondent's name/function	Approximate call duration	Comments
EPA				
Public Health Unit				
Fire and Rescue NSW				
Local Council				
WorkCover				
Other:				
Other:				
Summary of additional communication				
	3.3.C			

16. IMMEDIATE NOTIFICATION SHEET SUMMARY

Table 8 - Internal Reporting List

INTERNAL NOTIFICATIONS			
Name	Function	Phone number	Mobile number
			X.
			Z) Y
			/

Note: Contact details removed from online version for privacy reasons.

Table 9 - External Reporting List

Government Authority - compulsory notifications	Emergency notification phone number
EPA – Environment Line	131 555
Fire & Rescue NSW (FRNSW)	1300 729 579
Mid-Western Regional Council	1300 765 002
Public Health Unit (Greater Western) – Dubbo GW PHU	HealthLink (24 hr)- 1800 063 635 Head Office- Dubbo- 6841 5569
WorkCover Authority of NSW	131050 Company ABN asked: 51 000 187 002
Government Authority - ring if relevant	Emergency notification phone number
Police & Ambulance	000
Roads and Maritime Services (road spills)	132 701
NSW Office of Water	8838 7885
Bush Fire Control Officer	1800 049 933

Beryl Quarry – PIRMP-V14

Poisons Information Centre	131 126
Essential Energy (power line emergencies)	13 23 91

