

# Pollution Incident Response Management Plan

**GRAFTON QUARRY** 

Version Five: 19<sup>th</sup> September 2016



# **DOCUMENT CONTROL SHEET**

Ver.	Date	Prepared by	Approved By	Revision Details
01	20 Aug 2012	Rod Johnson	Rod Johnson	Document Created
02	21 Nov 2012	Nathan Jeffery	Rod Johnson	Document control sheet added Format Changes Added additional maps Chemical volumes stored onsite added Power Company Phone No updated
03	19 Nov 2013	Nathan Jeffery	Rod Johnson	Updated staff contact details Replaced reference map to reduce file size Added Immediate reporting contact sheet Updated ref. to Incident reporting SOP
04	25 Sep 2015	Nathan Jeffery	Rod Johnson	Updated staff contact details Formatting Changes Updated reference to HSEQ SOP Updated Risk Matrix to 5x5
05	19 Sep 2016	Nathan Jeffery	Nathan Jeffery	Updated Contact Details

Current Ver.	Date Implemented	PIRMP Test Schedule	Date for Next Review
05	Sep 2016	12 months	Sep 2017

# **TABLE OF CONTENTS**

DOCUMENT CONTROL SHEET	2
TABLE OF CONTENTS	3
1. PURPOSE	
2. LEGISLATIVE REQUIREMENTS	
3. DEFINITION OF 'POLLUTION INCIDENT'	5
4. SCOPE	
5. POTENTIAL POLLUTING SUBSTANCES	6
6. ROLES AND RESPONSIBILITIES	
7. INTERNAL POLLUTION INCIDENT REPORTING	
8. EXTERNAL POLLUTION INCIDENT REPORTING	
9. POLLUTION INCIDENT AUTHORITY CONTACT LIST	
10. INCIDENT RESPONSE TRAINING	
11. PIRMP AUDIT	13
12. PIRMP REVIEW	
a. EVENT BASED	
b. TIME BASED	
APPENDIX 1 - RISK ASSESSMENT on POTENTIAL IMPACTS	
APPENDIX 2 – PIRMP RESPONSE ACTIONS	
Incident No 1	
Incident No 2	
Incident No 3	
Incident No 4	20
Incident No 5	21
Incident No 6	
Incident No 7	23
Incident No 8	24
Incident No 9	
APPENDIX 3 – GRAFTON QUARRY LOCATION MAP	26
APPENDIX 4 – GRAFTON QUARRY REFERENCE MAP	
APPENDIX 5 – GRAFTON QUARRY – MAP OF AFFECTED AREAS	
APPENDIX 6 – Pollution Incident Notification Log	29
GRAFTON QUARRY PIRMP- Immediate Reporting Contact Sheet	31

#### 1. PURPOSE

The purpose of the Grafton Quarry Pollution Incident Response Plan is to:

- Provide direction to the staff at Grafton Quarry in responding to pollution incidents at the Grafton operations;
- Ensure timely communication about a pollution incident is provided to staff at the
  premises, the Environment Protection Authority (EPA), other relevant authorities
  specified in the Protection of the Environment Legislation Amendment Act (POELA Act)
  (including Clarence Valley Council, NSW Ministry of Health, Work Cover NSW, and Fire
  and Rescue NSW) and persons outside the operations who may be affected by the
  impacts of a pollution incident;
- Minimise and control the risk of a pollution incident at Grafton Quarry by identifying key risks and planned actions to minimise and manage those risks;
- Detail the training requirements for this plan, identifying persons responsible for implementing it, and ensuring that the plan is regularly tested for accuracy, currency and suitability.

#### 2. LEGISLATIVE REQUIREMENTS

The specific requirements for a PIRMP are set out in Part 5.7A of the POEO Act and the Protection of the Environment Operations (General) Regulation 2009 (POEO(G) Regulation). In summary, this provision requires the following:

- All holders of environment protection licences must prepare a pollution incident response management plan (section 153A, POEO Act).
- The plan must include the information detailed in the POEO Act (section 153C) and be in the form required by the POEO(G) Regulation (clause 98B).
- Licensees must keep the plan at the premises to which the environment protection licence relates (section 153D, POEO Act).
- Licensees must test the plan in accordance with the POEO(G) Regulation (clause 98E).
- if a pollution incident occurs in the course of an activity so that material harm to the environment is caused or threatened, licensees must immediately implement the plan (section 153F, POEO Act)

#### 3. DEFINITION OF 'POLLUTION INCIDENT'

The definition of a pollution incident is:

"pollution incident means an incident or set of circumstances during or as a consequence of which there is or is likely to be a leak, spill or other escape or deposit of a substance, as a result of which pollution has occurred, is occurring or is likely to occur. It includes an incident or set of circumstances in which a substance has been placed or disposed of on premises, but it does not include an incident or set of circumstances involving only the emission of any noise."

A pollution incident is required to be notified if there is a risk of 'material harm to the environment', which is defined in section 147 of the POEO Act as:

- a) harm to the environment is material if:
  - i. it involves actual or potential harm to the health or safety of human beings or to ecosystems that is not trivial, or
  - ii. it results in actual or potential loss or property damage of an amount, or amounts in aggregate, exceeding \$10,000 (or such other amount as is prescribed by the regulations), and
- b) loss includes the reasonable costs and expenses that would be incurred in taking all reasonable and practicable measures to prevent, mitigate or make good harm to the environment.

Grafton Quarry is now required to report pollution incidents immediately to the EPA, NSW Health, Fire and Rescue NSW, WorkCover NSW and the local council.

#### 4. SCOPE

This PIRMP must be followed by employees, contractors and visitors of Grafton Quarry, to assist in the early response to and reporting of a pollution incident.

#### **5. POTENTIAL POLLUTING SUBSTANCES**

The main hazards to human health and the environment at Grafton Quarry are included in the following table.

Name / description    Covered under Haz Chemicals/MSDS?   Chemicals and products which can cause pollution)    Diesel   Class 3   S 500 ltrs   Diesel Storage Area   Ref No "1   N/A	Site Name: Grafton Quarry						Responsible Person: Quarry Manager	<b>Date:</b> 19/9/2016
Diesel  Class 3  Class 3  Class 3  Class 3  Class 3  Class 3  Packaged goods up to 1 500 ltrs  Waste Oil 2 500 Ltrs  Diesel Storage Area  Ref No "1 N/A  Ref No "3 N/A  Ref No "5 N/A  Ref No "6 N/A  Ref	Name / description	Haz Chemicals/MSDS?	stored	storage	reference	early warning <sup>1</sup>		See Risk Ass & PIRMP Response Action (see
goods up to 1 500   Workshop   • PMP				Diesel			<ul> <li>PMP</li> <li>Training</li> <li>Spill Kits</li> <li>SOP</li> <li>Inductions</li> <li>Fire Fighting Equipment</li> </ul>	Incident #1-2
• Security	Oils/Solvents	Class 3	goods up to 1 500 ltrs Waste Oil	Shed near	Ref No #3	N/A	<ul> <li>PMP</li> <li>Training</li> <li>Flammable</li></ul>	Incident #3

<sup>&</sup>lt;sup>1</sup> Early warnings relate to informing neighbours who may be affected by the emission of this substance. If this substance is of a type and quantity which may reach neighbours then early warning assessment of actions is required to be undertaken. Grafton Quarry - PIRMP-V5

6 of 31

Oils/Fuel	Class 3	Variable	Plant and Equipment (Workshop area)	Ref No *2	N/A	<ul> <li>Concrete Floor</li> <li>Enclosed Shed</li> <li>Containment Cages and Cabinets</li> <li>PMP</li> <li>Training</li> <li>Spill Kits</li> <li>SOP</li> <li>Inductions</li> </ul>	Incident <sup>#</sup> 3
					1	<ul><li>Fire Fighting Equipment</li><li>Security</li></ul>	
	ockpiles, silos, bulk so		T	-			
Product Stockpiles	N/A	Variable	Dedicated on site	Ref No *8 & *9	N/A	<ul> <li>Water sprays</li> <li>Water Cart</li> <li>Maintain manageable levels</li> </ul>	Incident <sup>#</sup> 4
AQUEQUE ( l						<ul> <li>Security</li> </ul>	
Water Storage Dam (Sediment)	ns, wastewater tanks,	Variable		Ref No *6	N/A	<ul> <li>Continue to use for dust suppression</li> <li>Ensure pumps are maintained through scheduled maintenance</li> <li>Discharge monitoring</li> </ul>	Incident #5
Storm Water Drains	N/A	Variable	Site	N/A	N/A	<ul> <li>Straw Bales</li> <li>Rubber and         <ul> <li>Earthen Berms</li> </ul> </li> <li>Audits and         <ul> <li>Inspections</li> </ul> </li> </ul>	Incident <sup>#</sup> 5

Name / description	Covered under Haz Chemicals/MSDS?	Amount stored	Location of storage	Map reference	Need for early warning <sup>2</sup>	Current controls	See Risk Ass & PIRMP Response Action (see Below)
Mobile Plant (onsite) BORAL	Class 3	Up to 10 MP on site	Dedicated on site	N/A	N/A	<ul><li>Spill Kits</li><li>Pre start checks</li><li>PMP</li><li>Training</li></ul>	Incident <sup>#</sup> 6
Mobile Plant Contractor/visitor	Class 3	Variable	Variable Locations	N/A	N/A	<ul><li>Spill Kits</li><li>Training</li><li>Inductions</li></ul>	Incident <sup>#</sup> 7
Car Parking up to 20 vehicles	Class 3	Variable	Site Office	Ref No <sup>#</sup> 4	N/A	<ul><li>Spill Kits</li><li>Training</li></ul>	Incident <sup>#</sup> 8
Traffic Areas (dust, chem. leaks & loss	Class 3	N/A	Dedicated on site	N/A	N/A	<ul><li>Training</li><li>Water cart</li><li>Spill Kits</li></ul>	Incident <sup>#</sup> 9

<sup>&</sup>lt;sup>2</sup> Early warnings relate to informing neighbours who may be affected by the emission of this substance. If this substance is of a type and quantity which may reach neighbours then early warning assessment of actions is required to be undertaken.

# **6. ROLES AND RESPONSIBILITIES**

Position	Responsibility
Employees and Contractors	Following the procedures outlined in the PIRMP and related documents
	Immediately alerting Supervisor or Team Leader of any environmental incidents or near-misses.
Team Leaders / Front Line Supervisors	Following the procedures outlined in the PIRMP and related documents
	Immediately alerting Site/Quarry Manager or, in case of their unavailability, Environmental Representative or Environment Manager of any potentially material environmental incidents or near-misses. Conducting incident investigations.
Site / Operations Manager and/or	Authorisation of the PIRMP Administration, maintenance and implementation of the PIRMP
Site Environmental Coordinator and/or	Assessing whether the incident has caused or threatens "material environmental harm" and, if so, immediately notifying all Appropriate Regulatory Authorities.
Environment Manager	Ensuring that investigations are undertaken to a level corresponding to the level of risk and impact.

#### 7. INTERNAL POLLUTION INCIDENT REPORTING

Any pollution incident satisfying the *material harm* threshold must be immediately reported to relevant statutory authorities by either the Site/Operations Manager, or Environment Manager.

In cases where "material harm" level cannot be immediately assessed or insufficient information comes to hand on the severity of the incident, the general advice is to err on the side of caution and notify the Relevant Authorities with a qualification that the situation could not yet be fully assessed.

Until further notice the following procedure needs to be followed:

- 1. When a pollution incident occurs, a person who has become aware of it must immediately bring it to the attention of his/her immediate Supervisor or Manager
- 2. If necessary, first ring "000" for Emergency Services
- At least one of the following BCM personnel must be contacted **immediately**:

Whilst personal contact details for the following are available in the Controlled on site Pollution Incident Response

Management Plan they do not appear in this public document.

Name	Function	Phone number	Mobile number
	Grafton Quarry Manager		
	Grafton Quarry Supervisor		
	HSE Advisor – NSW/ACT		
	Environment Manager – NSW/ACT		

- 4. Brad Doyle or in case of his unavailability one of the Senior Management personnel listed above, is to **immediately** notify all Appropriate Regulatory Authorities specified in Section 4.3.
- 5. In borderline situations, where the exceedance of the trigger level of "material harm" of a pollution incident may not be clear, a quick assessment including consultation with Boral environmental personnel should be undertaken to help the decision whether to notify or not.
- 6. Boral's Senior Management must be informed promptly of the fact of immediate notification to the Authorities. This includes environmental personnel listed above, as well as Richard Tomkins, David Bolton, Greg Price and Anthony Henderson.

#### 8. EXTERNAL POLLUTION INCIDENT REPORTING

As the legislation requires that notification must be done immediately upon becoming aware of the pollution incident, it is unlikely that a detailed picture will be available for reporting. Notwithstanding, is seems that some of the Government Authorities prepared a detailed questionnaire which is being filled at the time of this initial notification. Under the stress of incident handling it could be easy to provide a hasty, inaccurate estimate of the situation when answering these questions.

Therefore, the notification should be restricted to the facts known and nothing should be assumed or guessed. The details will be provided to the asking Authority later when more information comes to hand.

The initial notification should include as much of the following information (if known) as possible:

- location and time of the pollution incident
- type of the incident (spill, fire, unlicensed harmful discharge, etc)
- assessed level of incident gravity: "it seems to be..." (e.g. "a relatively minor spill"; "major fire", "explosion limited to one building", etc.)
- whether the Emergency Services have been required to attend.

Unless known for a fact, the answers to other questions should be politely deferred until a better assessment of the situation can be made.

The Boral person who is responsible for notifying the Authorities (Site/Operations Manager or Environment Manager) about the incident must prepare a Notification Log (a suitable form is attached) with the details of time of notifications and the persons who took to the call. The Authorities are expected to log the calls but early indications are that this is not always the case.

Notification of all Appropriate Government Authorities (at least 5 entities) may take considerable time. Delays may be experienced connecting to the right person or no contact may be possible after hours. All such instances should be recorded in the Notification Log.

#### 9. POLLUTION INCIDENT AUTHORITY CONTACT LIST

Government Authority – compulsory notifications	Emergency notification phone number
EPA – Environment Line	131 555
Fire and Rescue NSW (FRNSW)	1300 729 579
Clarence Valley Council	BH 6643 0200 AH 6626 6858
Public Health Unit (Lismore NC AHS)	BH 6620 7585 AH 0 - 1300 149 377 (If no answer Ph 0417 244 966 or 0407 904 280)
WorkCover Authority of NSW	131050 Company ABN asked: 51 000 187 002
Government Authority – ring if relevant	Emergency notification phone number
	Emergency notification phone number  000
ring if relevant	
ring if relevant  Police & Ambulance	000
ring if relevant  Police & Ambulance  Roads and Maritime Services (road spills)	000 132 701
ring if relevant  Police & Ambulance  Roads and Maritime Services (road spills)  NSW Office of Water	000 132 701 8838 7885

Communication with the local community may also be undertaken depending on the circumstances of the pollution incident. Grafton Quarry would consider the following options for providing Early Warning and ongoing information to the community on pollution incidents:

- Direct phone contact with any local residents directly impacted by the pollution incident
- Letter Box drops of incident information and site contacts to local residents impacted by the pollution incident
- The inclusion of incident details within the relevant Quarry Community Newsletter

The Stakeholder Relations Manager can assist in the process of communicating with the community, as per the Stakeholder Engagement Plan for the site.

#### 10. INCIDENT RESPONSE TRAINING

Grafton Quarry will implement the Pollution Incident Response Management Plan by training or providing information to relevant employees and contractors in relevant areas of the Plan.

Training or information will be provided on the following;

- The contents and intent of this PIRMP,
- The roles and responsibilities of site staff in relation to this PIRMP
- Spill response procedures;
- General environmental awareness; and / or
- Hazardous materials awareness.

#### 11. PIRMP AUDIT

The objectives of an audit are to maintain compliance with this plan. Internal audits of this Plan will be undertaken every 3 years.

Routine testing of the plan will be conducted annually, and can be completed through the following methods:

- Simulated environmental emergency, or
- Desktop simulations.

#### 12. PIRMP REVIEW

Revisions are to be coordinated by the Site Manager and Environmental Representative.

The objectives of a review are:

- To maintain compliance with the statutory requirements, and
- To identify opportunities for improvement in the Plan, and reduce the risk to human health and the environment

#### a. EVENT BASED

Events which may trigger a review of this Plan or its associated documents include:

- Within 1 month of reporting to the nominated parties in accordance with the plan, after a pollution incident, or
- Modification/Improvement to the system

#### b. TIME BASED

Grafton Quarry will review this management plan routinely every 12 months. The Plan review will include:

- This Document, and
- Legislation, Approval and Licence changes.

# **APPENDIX 1 - RISK ASSESSMENT on POTENTIAL IMPACTS**

Hazard and Likelihood Risk Assessment and Corrective Control Measures								
Site: Grafton Quarry				Responsible Person:  Quarry Manager/Supervisor  Review Date:  19 <sup>th</sup> September 2016				
Name / ref of pollutant/ chemicals	Description of Hazard / Incident leading to hazard	Conseq uence	Likely hood	Risk	Impact on neighbours <sup>3</sup>	Control Measures Corrective Action Coverage under other Plans	Responsible person	Action date
Diesel	Incident #1 Catastrophic failure of one/both above ground tanks	1	1	L	N/A	Consequence: (Incidental): Failure resulting in loss of all or substantial volume of tanks would be captured entirely by existing primary bund with no release to soil or water.  Likelihood: (Rare): Tanks is a double walled self bunded storage tank. Due to location of tank damage to tanks is unlikely to occur from external equipment. In addition tanks are maintained in good structural integrity with low risk of failure through corrosion.	As per PIRMP action plan	When required
	Incident *2 Loss of diesel outside bund during refuelling/fuelling operations.	2	4	M	N/A	Consequence: (minor): Failure resulting in loss/leakage from fuelling or refuelling from hose, nozzle or plant/equipment would be captured by a self bunded fill point or spill kill with minimal release to soil.  Likelihood: (likely): Due to location within the tank structure an incident while re-fuelling and fuelling is likely to occur on some occasions. Hoses and refuelling equipment are maintained with low risk of failure.	As per PIRMP action plan	When required
Oils/Solvents	Incident *4 Loss of oils solvents inside bund during delivery and or use	1	1	L	N/A	Consequence: (Incidental): Failure resulting in loss of oils/solvents from packaged goods would be captured entirely by existing primary bund with no release to soil or water.  Likelihood: (Rare): Due to location within the bund, spillage during delivery and use is unlikely to occur. In addition hoses and decanting equipment are maintained in good structural integrity with low risk of failure.	As per PIRMP action plan	When required

<sup>&</sup>lt;sup>3</sup> If the incident may impact on neighbours then it will need to trigger the early warnings assessment and actions

Product stockpiles	Incident *5. Excessive airbourne	1	3	L	Y	Consequence: (Incidental): Excessive dust from stockpile during high winds causing nuisance to surrounding area.	As per PIRMP	When required
·	dust from stockpiled material					Likelihood: (Possible): Stockpiles are maintained to a manageable level on a monthly basis. Use of water sprinklers and water cart onsite during windy periods.	action plan	·
Sediment Dams	Incident *6 Catastrophic failure of one or more sediment dams releasing large volumes of water into on-site and off- site water courses (i.e creek).	2	2	L	N/A	Consequence: (Minor): Catastrophic failure of one or more sediment dams are likely to result in off-site impacts to water courses which would predominantly reduce water quality over a short period of time. As such, impact to the environment/human health is not considered to be significant. Likelihood: (unlikely): Dams are frequently monitored and inspected for levels and integrity.  Note: For PIRMP purposes overflow events during extreme wet weather will be reported under POEO Licence obligations and not Immediate Reporting.	As per PIRMP action plan	When required
Mobile Plant	Incident <sup>#</sup> 7  Mobile plant, hydraulic hose or fuel tank failure	2	4	М	N	Consequence: (minor): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site.  Likelihood: (Likely): Hose or fuel tank failure from mobile plant would be minimal as prestart and regular maintenance programs are in place to capture and prevent such occurrences. Spills kits also maintain and available in various areas.	As per PIRMP action plan	When required
Mobile plant/ Contractor, Visitor	Incident <sup>#</sup> 8  Mobile plant, hydraulic hose or fuel tank failure	2	2	L	N	Consequence: (minor): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site.  Likelihood: (Unlikely): Hose or fuel tank failure from mobile plant would be minimal as prestart and regular maintenance programs are in place to capture and prevent such occurrences. Spills kits also maintain and available in various areas. Inductions for all contractors demonstrating their accountabilities and responsibilities for reporting environmental incidents.	As per PIRMP action plan	When required
Car Park	Incident <sup>#</sup> 9 Ruptured fuel tank	2	1	L	N	Consequence: (minor): Failure from fuel tank or hydraulic hoses would be maintain to a small localised area on site.  Likelihood: (unlikely): Hose or fuel tank failure from employee or visitor car would be minimal. Car park area is fully sealed. Spill kits also maintain and available in various areas	As per PIRMP action plan	When required
Traffic areas (dust)	Incident # 10 Surface dust from mobile plant	1	3	L	Y	Consequence: (minor): Dust created form continuous mobile plant operations across site Likelihood: (unlikely): Main areas watered with water cart in high wind conditions	As per PIRMP action plan	When required

# **APPENDIX 2 – PIRMP RESPONSE ACTIONS**

#### Incident No 1

Incident #1	Catastrophic failure of one/both diesel tanks. Actions Required:
	<ul> <li>Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)</li> <li>Ensure bunds are capturing full volume of diesel</li> </ul>
	<ul> <li>Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)</li> <li>Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents</li> <li>Area to be restricted to Incident Response Personnel</li> </ul>
	Ensure spill kit available for any release from bund
	<ul> <li>If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.</li> </ul>
	Repair/replace tanks
	Refuel tanks
	Inspect bund for ongoing serviceability
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.
Emergency Controller	Quarry Manager
	Call service provider (Quarry Manager)
	Spill Kit manager (Supervisor)
	Periodic inspections and update reporting of site and bund (Quarry Manager)
Scale of incident	Incident would be restricted to Diesel/Precoast storage area with minimal external impact, however, potential for
	bund overflow or failure may result in soil and surface water contamination that will require specialist
	investigation/remediation.
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance
	after immediate notification.
Communications	Internal:
	• Quarry Manager
	Environment Manager &/or HSE Advisor      The sead above:
	External mandatory:
	Immediate Reporting Contact Sheet to be used     External non-mandatory: N/A
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting
	As per Site Emergency Plan or Fire Department as part of Immediate Reporting  As per Site Emergency Plan or Fire Department as part of Immediate Reporting
Rescue + First Aid	As per site timergency rian or rife bepartment as part or immediate reporting

Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.		
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)		

Actions Required:  Actions Required:  Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)  Ensure bunds are capturing full volume of diesel  Ensure bunds are capturing full volume of diesel  Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)  Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents  Area to be restricted to Incident Response Personnel  Ensure spill kit available for any release from bund  If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.  Repair/replace tanks  Refuel tanks  Inspect bund for ongoing serviceability  Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller  Quarry Manager  Quarry Manager  Call service provider (Quarry Manager)  Spill Kit manager (Supervisor)  Periodic inspections and update reporting of site and bund (Quarry Manager)  Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Communications  Internal:  Quarry Manager  Exerual mandatory:  Inmediate Reporting Contact Sheet to be used  External mandatory:  In mediate Reporting Contact Sheet to be used  External non-mandatory: N/A  Rescuer / respondent + safety checks	Incident *2	Loss of Fuel due to filling and refueling from one/both diesel tanks.				
Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)   Ensure bunds are capturing full volume of diesel   Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)   Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents   Area to be restricted to Incident Response Personnel   Ensure spill kit available for any release from bund   If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.   Repair/replace tanks	modern 2					
Ensure bunds are capturing full volume of diesel     Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)     Contact service provider (Caltex No. 180033111 or Transpacific 02 96007185) to pump-out bund contents     Area to be restricted to Incident Response Personnel     Ensure spill kit available for any release from bund     If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.     Repair/replace tanks     Refuel tanks     Inspect bund for ongoing serviceability  Alarm raising     Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller     Ouarry Manager     Call service provider (Quarry Manager)     Spill Kit manager (Supervisor)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Spill Kit manager (Supervisor)     Periodic inspections and update reporting of site and bund (Quarry Manager)  Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Evacuate  Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Communications  Internal:     Quarry Manager     Environment Manager &/or HSE Advisor – Enviro Representative     External mandatory:     Immediate Reporting Contact Sheet to be used     External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting						
Secuer   Result						
Contact service provider (Caltex No. 1800033111 or Transpacific 02 96007185) to pump-out bund contents   Area to be restricted to Incident Response Personnel   Ensure spill kit available for any release from bund   If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.   Repair/replace tanks   Refuel tanks   Inspect bund for ongoing serviceability   Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.   Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.   Part of the provider (Quarry Manager)   Call service provider (Quarry Manager)   Scale of incident   Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.   Internal:   Quarry Manager     Communications   Internal:   Quarry Manager     Environment Manager &/or HSE Advisor – Enviro Representative     External mandatory:     External mandatory:     Immediate Reporting Contact Sheet to be used     External non-mandatory: N/A     Rescuer / respondent + safety checks   As per Site Emergency Plan or Fire Department as part of Immediate Reporting						
Area to be restricted to Incident Response Personnel      Ensure spill kit available for any release from bund     If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.     Repair/replace tanks     Refuel tanks     Inspect bund for ongoing serviceability  Alarm raising     Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller     Quarry Manager     Call service provider (Quarry Manager)     Spill Kit manager (Supervisor)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Evacuate     Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Internal:     Quarry Manager     Environment Manager &/or HSE Advisor – Enviro Representative     External mandatory:     Immediate Reporting Contact Sheet to be used     External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting						
Ensure spill kit available for any release from bund     If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.   Repair/replace tanks     Repair/replace tanks     Inspect bund for ongoing serviceability     Alarm raising   Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.   Quarry Manager     Call service provider (Quarry Manager)     Spill Kit manager (Supervisor)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager)     Periodic inspections and update reporting of site and bund (Quarry Manager						
If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.   Repair/replace tanks   Repair/replace tanks   Repair/replace tanks   Refuel tanks   Inspect bund for ongoing serviceability		·				
investigate and remediate contamination.  Repair/replace tanks Refuel tanks Inspect bund for ongoing serviceability  Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller  Quarry Manager Call service provider (Quarry Manager) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Evacuate  Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Linernal: Quarry Manager Environment Manager &/or HSE Advisor – Enviro Representative External mandatory: Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting						
Refuel tanks Inspect bund for ongoing serviceability  Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller  Emergency Controller  Call service provider (Quarry Manager) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Communications  Internal: Quarry Manager Under or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Lourny Manager External mandatory: Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting						
Inspect bund for ongoing serviceability  Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller  Ouarry Manager Call service provider (Quarry Manager) Spill kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update		Repair/replace tanks				
Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Emergency Controller  Ouarry Manager Call service provider (Quarry Manager) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Communications Internal: Quarry Manager External mandatory: External mandatory: Inmediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.  Quarry Manager Periodic investigation (Quarry Manager and bund (Quarry Manager are with minimal external map advice provided by Fire Dept as part of attendance after immediate notification.  Internal: Purporting Contact Sheet to be used External mandatory: Prespondent + safety checks As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Refuel tanks				
implemented.  Emergency Controller  Ouarry Manager Call service provider (Quarry Manager) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager) Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Communications Internal: Ouarry Manager External mandatory: Internal mandatory: Inter		Inspect bund for ongoing serviceability				
Emergency Controller	Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be				
Call service provider (Quarry Manager) Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager)  Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Communications  Internal: Quarry Manager Penvironment Manager &/or HSE Advisor – Enviro Representative External mandatory: Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting to site and bund (Quarry Manager) Periodic inspections and update reporting area with minimal external impact. However, potential for bund output sufficient of site and bund (Quarry Manager) Periodic inspections and update reporting is and update reporting to site and bund (Quarry Manager) Periodic inspections and update reporting is and update reporting to site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manager) Periodic inspections and update reporting of site and bund (Quarry Manag		implemented.				
Spill Kit manager (Supervisor) Periodic inspections and update reporting of site and bund (Quarry Manager)  Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Evacuate Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Internal: Quarry Manager Invironment Manager &/or HSE Advisor – Enviro Representative External mandatory: Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Emergency Controller	Quarry Manager				
Periodic inspections and update reporting of site and bund (Quarry Manager)  Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Evacuate  Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Internal:  Quarry Manager  Environment Manager &/or HSE Advisor – Enviro Representative  External mandatory:  Immediate Reporting Contact Sheet to be used  External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Call service provider (Quarry Manager)				
Incident would be restricted to Diesel/Precoat storage area with minimal external impact. However, potential for bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Communications  Internal:  Quarry Manager  Quarry Manager  Environment Manager &/or HSE Advisor – Enviro Representative External mandatory:  Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Spill Kit manager (Supervisor)				
bund overflow or failure may result in soil and surface water contamination that will require specialist investigation/remediation.  Communications  Internal:  Quarry Manager Quarry Manager Penvironment Manager &/or HSE Advisor – Enviro Representative External mandatory: Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  Bund overflow or failure may result in soil and surface water contamination that will require specialist investigation.  Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate Report after Dept as part of Immediate Reporting to the total provided by Fire Dept as part of Immediate Reporting to the first potential exists. Quarry Manager and any advice provided by Fire Dept as part of Immediate Reporting to the Dept as part of Immediate Reporting to the first provided by Fire Dept as part of Immediate Reporting to the first potential exists. Quarry Manager and any advice provided by Fire Dept as part of Immediate Reporting to the De		<ul> <li>Periodic inspections and update reporting of site and bund (Quarry Manager)</li> </ul>				
investigation/remediation.  Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Internal:  Quarry Manager  Quarry Manager  Environment Manager &/or HSE Advisor – Enviro Representative  External mandatory:  Immediate Reporting Contact Sheet to be used  External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Scale of incident					
Communications Internal:  Quarry Manager  Quarry Manager  Quarry Manager  Rescuer / respondent + safety checks  Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.  Internal:  Quarry Manager  Environment Manager &/or HSE Advisor – Enviro Representative  External mandatory:  Immediate Reporting Contact Sheet to be used  External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting		bund overflow or failure may result in soil and surface water contamination that will require specialist				
After immediate notification.  Communications  Internal:  Quarry Manager  Environment Manager &/or HSE Advisor – Enviro Representative  External mandatory:  Immediate Reporting Contact Sheet to be used  External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting		investigation/remediation.				
Communications  Internal:  Quarry Manager  Environment Manager &/or HSE Advisor – Enviro Representative  External mandatory:  Immediate Reporting Contact Sheet to be used  External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance				
<ul> <li>Quarry Manager</li> <li>Environment Manager &amp;/or HSE Advisor – Enviro Representative</li> <li>External mandatory:         <ul> <li>Immediate Reporting Contact Sheet to be used</li> <li>External non-mandatory: N/A</li> </ul> </li> <li>Rescuer / respondent + safety checks         <ul> <li>As per Site Emergency Plan or Fire Department as part of Immediate Reporting</li> </ul> </li> </ul>		after immediate notification.				
<ul> <li>Environment Manager &amp;/or HSE Advisor – Enviro Representative         External mandatory:         <ul> <li>Immediate Reporting Contact Sheet to be used</li> <li>External non-mandatory: N/A</li> </ul> </li> <li>Rescuer / respondent + safety checks         <ul> <li>As per Site Emergency Plan or Fire Department as part of Immediate Reporting</li> </ul> </li> </ul>	Communications	Internal:				
External mandatory:  • Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Quarry Manager				
• Immediate Reporting Contact Sheet to be used External non-mandatory: N/A  Rescuer / respondent + safety checks As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Environment Manager &/or HSE Advisor – Enviro Representative				
Rescuer / respondent + safety checks  As per Site Emergency Plan or Fire Department as part of Immediate Reporting		External mandatory:				
Rescuer / respondent + safety checks As per Site Emergency Plan or Fire Department as part of Immediate Reporting		Immediate Reporting Contact Sheet to be used				
		External non-mandatory: N/A				
Rescue + First Aid  As per Site Emergency Plan or Fire Department as part of Immediate Reporting	Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
	Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				

Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.		
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)		

Incident #4	Loss off oil/solvents, packaged goods.				
	Actions Required:				
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)				
	Ensure bunds are capturing full volume of oil/solvents				
	<ul> <li>Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)</li> </ul>				
	<ul> <li>Contact service provider (Caltex No. 1800033111or Transpacific 02 96007185) to pump-out bund contents</li> </ul>				
	Area to be restricted to Incident Response Personnel				
	Ensure spill kit available for any release from bund				
	<ul> <li>If any release from bund onto unsealed soil/surface water - Environmental Consultants to be engaged to investigate and remediate contamination.</li> </ul>				
	Inspect bund for ongoing serviceability				
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be				
	implemented.				
<b>Emergency Controller</b>	Quarry Manager				
	Call service provider (Quarry Manager)				
	Spill Kit manager (Supervisor)				
	<ul> <li>Periodic inspections and update reporting of site and bund (Quarry Manager)</li> </ul>				
Scale of incident	Incident would be restricted to chemical storage area with minimal external impact. However, potential for bund				
	overflow or failure may result in soil and surface water contamination that will require specialist				
	investigation/remediation.				
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance				
	after immediate notification.				
Communications	Internal:				
	Quarry Manager				
	Environment Manager &/or HSE Advisor – Enviro Representative				
	External mandatory:				
	Immediate Reporting Contact Sheet to be used				
	External non-mandatory: N/A				
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Clean up and	Service Provider to dispose of diesel, oil, grease and advise on required clean-up.				

Waste disposal	
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)

Incident #5	Excessive airbourne dust from stockpiled material.				
	Actions Required:  • Employees, Contractor/Visitor to notify site representative of issue immediately. (induction)				
	Daily monitoring to be undertaken to assess weather and site conditions				
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)				
	Dust suppression activity to commence immediately on stockpiles				
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.				
Emergency Controller	Quarry Manager				
	Call service provider (Quarry Manager)				
	Spill Kit manager (Supervisor)				
	Periodic inspections and update reporting of site and bund (Quarry Manager)				
Scale of incident	Incident would be localised to the area surrounding stockpile area, with minimal external impact.				
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after immediate notification.				
Communications	Internal:				
	Quarry Manager				
	Environment Manager &/or HSE Advisor – Enviro Representative				
	External mandatory:				
	Immediate Reporting Contact Sheet to be used				
	External non-mandatory: N/A				
Rescuer / respondent + safety checks					
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.				
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)				

Incident *6	Failure of one or more sediment dams. Actions Required:				
	<ul> <li>Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)</li> </ul>				
	<ul> <li>Ensure bund integrity is sound throughout the entire period of incident (i.e. periodic inspections)</li> <li>Contact local neighbours if going to be in inundated by rise of water</li> </ul>				
	Area to be restricted to Incident Response Personnel				
	If any release from site onto unsealed soil/surface water - Environmental Consultants to be engaged to				
	investigate and remediate contamination if any				
	Contact local contractor to rebuild dams immediately				
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be				
Emergency Controller	implemented.				
Lineigency Controller	<ul><li>Quarry Manager</li><li>Call service provider (Quarry Manager)</li></ul>				
	Spill Kit manager (Supervisor)				
	<ul> <li>Periodic inspections and update reporting of site and bund (Quarry Manager)</li> </ul>				
Scale of incident	Catastrophic failure of one or more sediment dams are likely to result in off-site impacts to water courses which				
Scale of incluent	would predominantly reduce water quality over a short period of time. As such, impact to the environment/human				
	health is not considered to be significant.				
Evacuate	Only if flood potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance after				
	immediate notification.				
Communications	Internal:				
	Quarry Manager				
	Environment Manager &/or HSE Advisor – Enviro Representative				
	External mandatory:				
	Immediate Reporting Contact Sheet to be used				
	External non-mandatory: N/A				
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Clean up and Waste disposal	Consultants to be contacted to advise on required clean-up.				
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)				

Incident <sup>#</sup> 7	Mobile plant, hydraulic hose or fuel tank failure.					
	Actions Required:					
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)					
	Area to be restricted to Incident Response Personnel					
	Ensure spill kit available for any release from mobile plant & equipment					
	If any release from mobile plant onto unsealed soil/surface water is investigated and remediated					
	immediately					
	Call service provider to inspect plant & equipment for serviceability					
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be					
	implemented.					
Emergency Controller	Quarry Manager					
	Call service provider (Quarry Manager)					
	Spill Kit manager (Supervisor)					
	Periodic inspections and update reporting of site and bund (Quarry Manager)					
Scale of incident	Incident would be localised to the area with no external impact.					
Evacuate	Only if fire or explosion potential exists. Quarry Manager and any advice provided by Fire Dept as part of attendance					
	after immediate notification.					
Communications	Internal:					
	Quarry Manager					
	Environment Manager &/or HSE Advisor – Enviro Representative					
	External mandatory:					
	Immediate Reporting Contact Sheet to be used					
	External non-mandatory: N/A					
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting					
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting					
Clean up and Waste disposal	Service Provider to dispose of diesel and advise on required clean-up.					
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)					


Incident <sup>#</sup> 8	Mobile plant, hydraulic hose or fuel tank failure from contractors / visitors.				
melacite o	Actions Required:				
	Contractor/Visitor to notify site representative of issue immediately. (induction)				
	Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)				
	Area to be restricted to Incident Response Personnel				
	Ensure spill kit available for any release from mobile plant & equipment				
	<ul> <li>If any release from mobile plant onto unsealed soil/surface water is investigated and remediated</li> </ul>				
	immediately				
	Call service provider to inspect plant & equipment for serviceability				
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be				
-	implemented.				
<b>Emergency Controller</b>	Quarry Manager				
	Call service provider (Quarry Manager)				
	Spill Kit manager (Supervisor)				
	<ul> <li>Periodic inspections and update reporting of site and bund (Quarry Manager)</li> </ul>				
Scale of incident	Incident would be localised to the area with no external impact.				
Evacuate	Only if fire or explosion potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after immediate notification.				
Communications	Internal:				
	Wayne Beattie - Quarry Manager				
	Environment Manager &/or HSE Advisor – Enviro Representative				
	External mandatory:				
	Immediate Reporting Contact Sheet to be used				
	External non-mandatory: N/A				
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting				
Clean up and Waste disposal	Service Provider to dispose of contaminates.				
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)				

Incident #9	Car Park/ fuel tank failure.					
	Actions Required:					
	Contractor/Visitor to notify site representative of issue immediately. (induction)					
	Area to be restricted to Incident Response Personnel					
	Ensure spill kit available for any release from mobile plant					
	If any release from mobile plant onto unsealed soil/surface water is investigated and remediated					
	immediately					
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be implemented.					
<b>Emergency Controller</b>	Quarry Manager					
	Spill Kit manager (Supervisor)					
Scale of incident	Incident would be localised to the area with no external impact.					
Evacuate	Only if fire or explosion potential exists. Plant Manager and any advice provided by Fire Dept as part of attendan					
	after immediate notification.					
Communications	Internal:					
	Quarry Manager					
	Environment Manager &/or HSE Advisor – Enviro Representative					
	External mandatory:					
	Immediate Reporting Contact Sheet to be used					
	External non-mandatory: N/A					
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting					
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting					
Clean up and Waste disposal	Service Provider to dispose of contaminate					
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)					

#						
Incident #10	Dust from traffic areas.					
	Actions Required:					
	<ul> <li>Employees, Contractor/Visitor to notify site representative of issue immediately. (induction)</li> </ul>					
	<ul> <li>Daily monitoring to be undertaken to capture whether and site conditions</li> </ul>					
	<ul> <li>Contact all relevant people/department (refer to Immediate Reporting Contact Sheet)</li> </ul>					
	<ul> <li>Dust suppression activity to commence immediately on unsealed roads &amp; dusty areas of site</li> </ul>					
Alarm raising	Any personnel involved or witnessing incident to report to immediate supervisor and PIRMP actions to be					
	implemented.					
Emergency Controller	Quarry Manager					
	<ul> <li>Quarry Manager to instruct site personnel (Quarry Manager)</li> </ul>					
Scale of incident	Incident would be localised to the area with minimal external impact.					
Evacuate	Only if fire or potential exists. Plant Manager and any advice provided by Fire Dept as part of attendance after					
	immediate notification.					
Communications	Internal:					
	Quarry Manager					
	External mandatory:					
	Immediate Reporting Contact Sheet to be used if required					
	External non-mandatory: N/A					
Rescuer / respondent + safety checks	As per Site Emergency Plan or Fire Department as part of Immediate Reporting					
Rescue + First Aid	As per Site Emergency Plan or Fire Department as part of Immediate Reporting					
Clean up and Waste disposal	N/A					
Reporting and re-preparedness	See Incident Notification SOP (GRP-HSEQ-3-02)					

Grafton Quarry – PIRMP-V5 25 of 31

# **APPENDIX 3 – GRAFTON QUARRY LOCATION MAP**

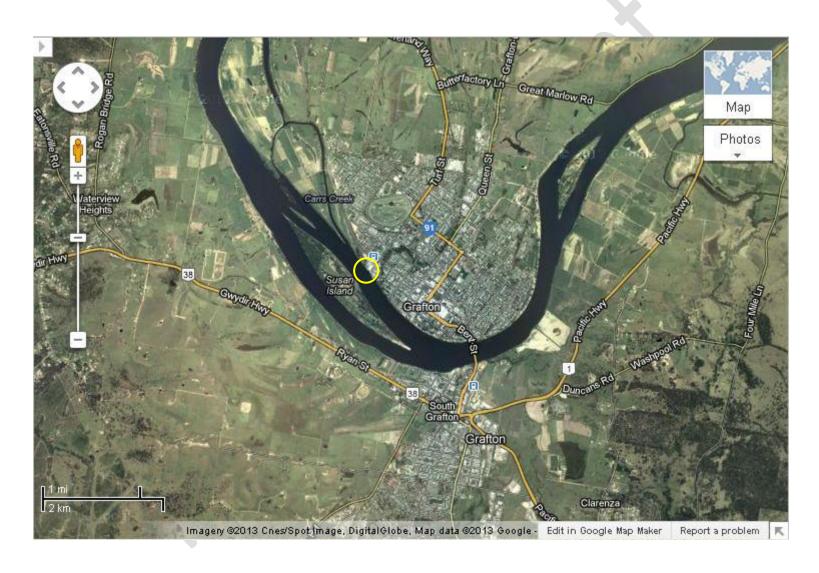

Grafton Quarry – PIRMP-V5 26 of 31

#### **APPENDIX 4 – GRAFTON QUARRY REFERENCE MAP**



Grafton Quarry – PIRMP-V5 27 of 31

# **APPENDIX 5 – GRAFTON QUARRY – MAP OF AFFECTED AREAS**



Grafton Quarry – PIRMP-V5 28 of 31

# **APPENDIX 6 – Pollution Incident Notification Log**

Person undertaking (Name/Function):	notification				
Date and time when incident:	n first become aw	are of the			
Incident type:					
Comments:					
Initial immediate n	otification log	1			
Appropriate Regulatory Authority	Time of call	Respond name/fui	ent's nction	Approximate call duration	Comments
EPA					
Public Health Unit					
Fire and Rescue NSW					
Local Council					
WorkCover					
Other:					
Other:					
Summary of initial o	communication:				

Person undertaking notification (Name/Function):						
Date and time when additional information become available:						
Comments:						
L		_		_		
Immediate notification of further pertinent information (if applicable)						
Appropriate Regulatory Authority	Time of call	Respondent's name/function	Approximate call duration	Comments		
EPA						
Public Health Unit						
Fire and Rescue NSW						
Local Council						
WorkCover						
Other:						
Other:						
Summary of additional communication						

# **GRAFTON QUARRY PIRMP- Immediate Reporting Contact Sheet**

Whilst personal contact details for the following are available in the Controlled on site Pollution Incident Response

Management Plan they do not appear in this public document.

INTERNAL NOTIFICATIONS					
Name	Function	Phone number	Mobile number		
	Grafton Quarry Manager		X		
	Grafton Quarry Supervisor				
	HSE Advisor – NSW/ACT				
	Environment Manager – NSW/ACT				
	Country Operations Manager – Quarries				
	Regional Manager – Quarries NSW/ACT				

EXTERNAL NOTIFICATIONS				
Government Authority - compulsory notifications	Emergency notification phone number			
EPA – Environment Line	131 555			
Fire and Rescue NSW (FRNSW)	1300 729 579			
Clarence Valley Council	BH 6643 0200 AH 6626 6858			
Public Health Unit (Lismore NC AHS)	BH 6620 7585 AH 0 - 1300 149 377 (If no answer Ph 0417 244 966 or 0407 904 280)			
WorkCover Authority of NSW	131050 Company ABN asked: 51 000 187 002			

NOTE: A full listing of contact phone numbers of other potentially relevant government agencies is included in the PIRMP.